### **Universal Instruction Manual**

I/A Series® Pressure Transmitters Models IAP10, IAP20, IGP10, IGP20, IGP25 and IGP50, IDP10, IDP25, IDP50

Configuration, Calibration, Installation, and Operation

Safety information in many languages is available on our website. For help downloading this information, contact our Global Customer Support Center.



## **Contents**

Figures	7
Tables	9
Preface	11
1. Safety Information	13
Transmitter Identification	13
Supply Voltage	13
Electrical Certification Rating	14
PED Certification	14
Pressure Rating	14
Pressure Seal PSFLT	15
Pressure Seals PSFPS and PSFES	16
Pressure Seals PSFAR and PSFAD	17
Pressure Seals PSTAR and PSTAD	17
Pressure Seals PSISR and PSISD	17
Pressure Seals PSSCR and PSSCT	18
PSSSR and PSSST (Sanitary Tank Spud) Seals	18
Origin Code	18
Operating Temperature Limits	18
Process Wetted Materials	22
Pressure Seals PSFLT, PSFPS, and PSFES	22
Pressure Seals PSFAR, PSFAD, PSTAR, PSTAD, PSISR, and PSISD	22
Pressure Seals PSSCR	23
Pressure Seals PSSCT	24
Pressure Seals PSSSR and PSSST	24
Warnings	24
General Warning	
ATEX Warnings	
Explosionproof/Flameproof and Enclosure Warning	
Intrinsically Safe and Type n Warning	
Type n Warning	
Pressure Warnings	
Process Fluid Warning	
Seal or Sensor Fill Fluid Warning.	
Parts Replacement Warning	
EC Declaration of Conformity	

2. Installation	31
Mechanical Installation	31
Differential Pressure Transmitter	31
Process-Mounted Transmitter	31
Manifold Mounted Transmitter	32
Pipe- or Surface-Mounted Transmitter	
Venting and Draining	39
Installation of Flow Measurement Piping	40
Filling System with Seal Liquid	42
Absolute and Gauge Pressure Transmitter	
IAP10, IGP10, IGP25 and IGP50 Transmitters	43
IAP20 and IGP20 Transmitters	44
Typical Transmitter Piping	
Transmitter with Seals	46
Positioning the Housing	46
Positioning the Display	47
Setting the Write Protect Jumper	47
Cover Locks	48
Wiring	48
4 to 20 mA Output Signal (Model Codes -A, -D, and -T)	49
HART Multidrop Wiring (Model Code -T)	53
1 to 5 V dc Output Signal (Model Code -V)	54
Power Supply Voltage and Current	54
Output Load	54
Three or Four Wire Connections	54
FoxCom Communications Protocol (Model Code -D)	57
Foundation Fieldbus Communication (Model Code -F)	59
Installing Fieldbus Software (Model Code -F)	61
Putting a Differential Pressure Xmtr Into Operation	61
Taking a Differential Pressure Xmtr Out of Operation	62
3. Operation Using Local Display	63
Moving Through the Menu Structure	65
Entering Numerical Values	
Zeroing from the LCD Indicator Pushbuttons or Optional External Zero Button	66
Zeroing from a HART Communicator	
4. Calibration	69
Calibration Diagram	69
Liquid Level Application Calibrated Range Values	70
Method #1 - Calculating the range values	

Method #2 - Using the Transmitters to Determine the Range Values	73
Method #3 - Getting the Local Indicator and Transmitted Value to Indicate Level - HART Transmitters	
Method #4 - Getting the Local Indicator and Transmitted Value to Indicate Level - Analog Output Transmitters	g
5. Configuration Diagrams	77
FoxCom Communications (Code -D)	
HART Communications (Code -T)	80
Foundation Fieldbus Communications (Code -F)	82
4 to 20 mA (Code -A) and 1 to 5 V dc (Code -V)	83

# **Figures**

1	Sample Iransmitter Identification	
2	Sample Seal Data Plate	14
3	Pressure Connections	26
4	Sensor Replacement	
5	Sensor Replacement (pvdf Inserts)	
6	Typical Mounting of an IDP Transmitter Supported by Process Piping	32
7	Typical Mounting of an IDP Transmitter Supported by a Bypass Manifold	32
8	Typical Mounting of M4A and M4T Manifold with -AM Bracket	33
9	Typical Mounting of MB3 Manifold with -AM Bracket	
10	Typical Mounting of IMV25 Transmitter on Coplanarä Manifold	
11	Pipe or Surface Mounted Transmitter Using a Standard Bracket	
12	Examples of Mounting With a Standard Bracket	35
13	Details of a Universal Bracket	
14	Mounting a Transmitter with Traditional Structure Using a Universal Bracket	36
15	Vertical Pipe Mounting a Transmitter with LP2 Structure Using a Universal Bracket	37
16	Horizontal Mounting a Transmitter with LP2 Structure Using a Universal Bracket	38
17	Vertical Mounting - Cavity Draining	39
18	Vertical Mounting - Cavity Venting	39
19	Horizontal Mounting - Cavity Venting	39
20	Vertical Mounting - Cavity Venting	40
21	Horizontal Mounting - Cavity Venting and Draining	40
22	Cavity Venting and Draining	40
23	Example of Horizontal Process Line Installation	41
24	Example of Vertical Process Line Installation	
25	IAP10, IGP10, IGP25, and IGP50 Transmitter Mounting	43
26	IAP20 and IGP20 Transmitter Mounting	
27	Typical Transmitter Piping (IGP10 shown)	45
28	Hot Process Piping	46
29	Housing Screw or Clip Location	47
30	Accessing Field Terminals	
31	Identification of Field Terminals	49
32	Supply Voltage and Loop Load	50
33	Loop Wiring 4 to 20 mA Output Transmitters	52
34	Wiring Several 4 to 20 mA Transmitters to a Common Power Supply	52
35	Typical Multidrop Network	53
36	Identification of Field Terminals	54
37	Three-wire Connection	55
38	Four-wire Connection	55
39	Loop Wiring (four-wire connection shown)	
40	Wiring Several Transmitters to a Common Power Supply	57
41	Typical Transmitter Wiring to an I/A Series System	
42	Wiring Diagram of Typical FOUNDATION Fieldbus Transmitter Installation	60
43	Local Display Module	64

44	Top Level Structure Diagram	64
45	Typical Menu Structure	
46	Calibration Structure Diagram	69
47	Calibration Structure Diagram (Continued)	70
48	Transmitter Connected to Open Tank	71
49	Transmitter Connected to Closed Tank with Dry Leg	71
50	Transmitter Connected to Closed Tank with Wet Leg	71
51	Transmitter Connected to Closed Tank With Dual Seals	
52	FoxCom Configuration Structure Diagram	77
53	FoxCom Configuration Structure Diagram (Continued)	78
54	FoxCom Configuration Structure Diagram (Continued)	
55	Configuration Structure Diagram	
56	Configuration Structure Diagram (Continued)	
57	Configuration Structure Diagram (Continued)	
58	Configuration Structure Diagram (Code -A and -V)	

## **Tables**

1	Pressure Seal PSFLT Pressure Limits	15
2	Pressure Seal PSFPS and PSFES Pressure Limits	16
3	Pressure Seals PSFAR and PSFAD Pressure Limits	17
4	Pressure Seals PSTAR and PSTAD Pressure Limits	17
5	Interpretation of Model Code for IDP10, IAP20, IGP20, IDP25, and IDP50 Transmir	tters
	19	
6	Interpretation of Model Code for IAP10, IGP10, IGP25, and IGP50 Transmitters	20
7	Sensor Body Operating Temperature Limits for Models Listed in Tables 5 and 6	21
8	Seal Fill Fluid and Operating Temperature Limits	
9	Pressure Seal PSFLT, PSFPS, and PSFES Wetted Materials	22
0	Pressure Seal Lower Housing Materials	22
1	Pressure Seal Diaphragm Materials	23
2	Pressure Seal Gasket Materials	23
3	Pressure Seal PSSCR Diaphragm Materials	23
4	Capillary Fill Fluid Specific Gravities	46
5	Minimum Supply Voltage Requirements	59

## **Preface**

This Universal Instruction Manual is designed to provide the user with a single, concise, easy-to-use manual that covers the key points needed for configuration, calibration, installation, and operation of I/A Series Pressure Transmitters.

It covers all models of single variable pressure transmitters in the I/A Series family, including absolute, gauge, and differential pressure transmitters, with FoxCom, HART, FOUNDATION fieldbus, or analog output electronics.

This universal manual, along with a DVD containing detailed information, is provided free of charge with every I/A Series Pressure Transmitter, unless the purchaser requests that these two items be omitted.

For additional detailed information about each model, including dimensional prints, parts lists, and more detailed instructions, please refer to the standard DVD supplied or the optional paper instruction book that is available for each model in the line.

- ♦ Standard Documentation Shipped with every I/A Series Pressure Transmitter
  - ◆ A brief "Getting Started" Pocket-Sized Bulletin
  - ♦ This Universal Instruction Manual
  - ◆ A DVD that contains the complete documentation set for I/A Series Pressure Transmitters
- When Optional Feature K1 is specified in the Model Code when the transmitter is ordered:

A brief "Getting Started" Pocket-Sized Bulletin only is supplied

Optional Feature K1 is offered for those users who want to omit the documentation shipped with every transmitter. This may be specified when multiple identical transmitters are ordered and the user does not want multiple sets of documentation.

# 1. Safety Information

### Transmitter Identification

A typical data plate is shown in Figure 1.

THIS PRODUCT IS PROTECTED BY ONE OR MORE OF THE FOLLOWING U.S. DISSE, DOC. 4,003,607. 6,365,600. 6,407,501. 6,560,204. 6,550, TOR & OTHERS PRODUCED CORPESSFORMER PATTERS IN HAVE REPORTED FOR ARRIVE PATHOLOGY OF THE PROTECTION OF A CONTROL OF PED 97/23/EC PERMANENTLY MARK ONE TYPE OF PROTECTION, ONCE CHOOSEN, IT CAN NOT CHANGE, NOT FOLLOWING THESI INSTRUCTIONS WILL JEOPARDIZE EXPLOSION SAFETY.

SEE CERTIFICATES FOR ELECTRICAL DATA C € 0575 Ex II 2G EEx d IIC T6 KEMA OOATEX 2019 X **C**€0344 IT IS EEX IN IIC 74...76
IT IN IIC 74...76
IT IS EEX IN IIC 74...76
IT SILICONE FILL -46 AND 121 C C В D Ε MODEL IDP10-D(12)A 21(E) A 3 ST. SEAL HI: SEAL LO: CAL. RANGE AUX. SPEC. REFERENCE **SUPPLY** 11.5 - 42 V dc ORIGIN 2A0125 CUST, TAG PS / MWP = 3625 psi **CAUTION: CABLE ENTRIES** COMMUNICATION THIS PRODUCT IS PROTECTED BY ONE OR MORE OF THE FOLLOWING U.S. PATENTS D366,000; 6,038,927; 5,285,800; 5,407,501; 5,583,294; 5,666,782 & OTHERS PENDING. CORRESPONDING PATENTS HAVE BEEN ISSUED OR ARE PENDING IN OTHER COUNTRIES. invensys FOXBORO

Figure 1. Sample Transmitter Identification

Review the model code on the data plate attached to your transmitter to determine its electrical, pressure, and hazardous location ratings.

### Supply Voltage

The proper supply voltage is printed on the data plate. See Item C on the example shown in Figure 1. Ensure that the proper electrical source is connected to the transmitter.

### **Electrical Certification Rating**

The electrical safety design code is printed on the data plate as part of the model code. See Item B on the example shown in Figure 1. See the "Product Safety Specifications" section of the instruction pertaining to your instrument on the enclosed DVD to identify this code. The type of protection is also marked on the data plate. See Item D on the example shown in Figure 1.

#### PED Certification

The PED (Harmonized Pressure Equipment Directive for the European Community) certification is offered only with transmitters ordered with ATEX Electrical Safety Design Code selections. Transmitters with PED certification have a CE marking on the data plate that also carries the PED number 0575.

### **Pressure Rating**

The maximum working pressure (PS or MWP) for the transmitter is printed on the data plate. See Item F on the example shown in Figure 1.

The data plate of flanged level transmitters and transmitters with flanged pressure seals are stamped with the MWP if the transmitter pressure range is the limiting factor. It is stamped "Flange Rate" if the flange rating is the limiting factor. The MWP of the flanged seal is stamped on the seal data plate. See Figure 2.

Figure 2. Sample Seal Data Plate

MODEL CODE: PSFPS-A2S0E313B MWP: 275 psig at 100°F NOTICE: BREAKING CONNECTIONS VOIDS WARRANTY
BE SURE FILL FLUID CAN MIX SAFELY WITH PROCESS HIGH SIDE SEAL
HIGH SIDE FLUID, DC200, 10 cSt SILICONE TEMP RANGE -40 TO +450°F
PROCESS WETTED MATERIAL 316 SS

When using transmitters with threaded, in-line saddle weld, or sanitary pressure seals, compare the MWP of the transmitter on the transmitter data plate and the MWP of the seals on the seals data plates and use the lesser value as the system MWP.

The MWP on the seal data plates may not be given at your process temperature. Use the following information and industry standards as required to determine the actual pressure limits for your application.

### Pressure Seal PSFLT

Table 1. Pressure Seal PSFLT Pressure Limits

Process Connections		Maximum Working Pressure		
Flange	Process Temperature (a)	Carbon Steel (b)	316L Stainless Steel (c)	
ANSI Class 150 (d)	100°F	285 psig	275 psig	
	200°F	260 psig	240 psig	
	300°F	230 psig	215 psig	
	450°F	185 psig	183 psig	
ANSI Class 300 (d)	100°F	740 psig	720 psig	
	200°F	675 psig	620 psig	
	300°F	655 psig	560 psig	
	450°F	618 psig	498 psig	
ANSI Class 600 (d)	100°F	1480 psig	1440 psig	
	200°F	1350 psig	1240 psig	
	300°F	1315 psig	1120 psig	
	450°F	1235 psig	993 psig	
DIN PN 10/16 (e)	50°C	16 bar	16 bar	
	100°C	16 bar	16 bar	
	150°C	14.5 bar	14 bar	
	250°C	11 bar	10.5 bar	
DIN PN 10/40 and PN 25/40 (e)	50°C 100°C 150°C 250°C	40 bar 40 bar 37.5 bar 32 bar	40 bar 35 bar 33.5 bar 30 bar	

a. Flange temperature/pressure ratings only; seal temperature ratings may be lower; refer to Table 8.

b. ASME/ANSI Material Group 1.1; linear interpolation acceptable.

c. ASME/ANSI Material Group 2.2; linear interpolation acceptable.

d. ANSI flanges per ASME/ANSI B16.5-1988.

e. DIN flanges per BS4504.

#### Pressure Seals PSFPS and PSFES

Table 2. Pressure Seal PSFPS and PSFES Pressure Limits

Process Connection		Maximum Working Pressure		
Flange	Process Temperature (a)	Carbon Steel (b)	316L Stainless Steel (c)	
ANSI Class 150 (d)	100°F	285 psig	275 psig	
	200°F	230 psig	240 psig	
	400°F	200 psig	195 psig	
	500°F	170 psig	170 psig	
	600°F	140 psig	140 psig	
ANSI Class 300 (d)	100°F	740 psig	720 psig	
	200°F	675 psig	620 psig	
	400°F	635 psig	515 psig	
	500°F	600 psig	480 psig	
	600°F	550 psig	450 psig	
ANSI Class 600 (d)	100°F	1480 psig	1440 psig	
	200°F	1350 psig	1240 psig	
	400°F	1270 psig	1030 psig	
	500°F	1200 psig	955 psig	
	600°F	1095 psig	905 psig	
DIN PN 10/16 (e)	50 °C	16 bar	16 bar	
	100 °C	16 bar	16 bar	
	150 °C	14.5 bar	14 bar	
	200 °C	13 bar	12 bar	
	300 °C	9 bar	9 bar	
DIN PN 10/40 and PN 25/40 (e)	50 °C 100 °C 150 °C 200 °C 300 °C	40 bar 40 bar 37.5 bar 35 bar 28 bar	40 bar 35 bar 33.5 bar 32 bar 28 bar	

a. Flange temperature/pressure ratings only; seal temperature ratings may be lower; refer to Table 8.

b. ASME/ANSI Material Group 1.1; linear interpolation acceptable.

c. ASME/ANSI Material Group 2.2; linear interpolation acceptable.

d. ANSI flanges per ASME/ANSI B16.5-1988.

e. DIN flanges per BS4504.

#### Pressure Seals PSFAR and PSFAD

Process		Pressure Rating in psig (b)			
Connection Process Flange Temperature (		Class 150	Class 300	Class 600	Class 1500
ANSI Carbon Steel	-20°F 100°F 200°F 300°F 400°F 500°F 580°F	285 285 260 230 200 170 146	740 740 675 655 635 600 560	1480 1480 1350 1315 1270 1200 1120	3705 3705 3375 3280 3170 2995 2785
ANSI Stainless Steel	-20°F 100°F 200°F 300°F 400°F 500°F 580°F	275 275 240 215 195 170 146	720 720 620 560 515 480 456	1440 1440 1240 1120 1030 955 915	3600 3600 3095 2795 2570 2390 2280

Table 3. Pressure Seals PSFAR and PSFAD Pressure Limits

#### Pressure Seals PSTAR and PSTAD

Table 4. Pressure Seals PSTAR and PSTAD Pressure Limits

	Bolting Code "S"		Bolting Code "C"	
Process Temperature	2 and 3 inch	4 inch	2 and 3 inch	4 inch
20°F 100°F 200°F 300°F 400°F 500°F 580°F	1250 1250 1075 975 900 835 803	750 750 645 585 540 500 481	2500 2500 2150 1950 1800 1670 1606	1500 1500 1290 1170 1080 1000 963

Seal temperature rating may be lower depending on mounting and fill fluid; refer to Table 8.

The pressure rating is dependent on the diaphragm size and the bolting material. The diaphragm size and bolting material are identified in the pressure seal model number which is located on the pressure seal. See following example:

#### Pressure Seals PSISR and PSISD

The maximum working pressure is equivalent to a nominal 3- or 4-inch Schedule 40 pipe as defined by ASME/ANSI standards.

a. Flange temperature/pressure ratings only; seal temperature rating may be lower depending on mounting and fill fluid; refer to Table 8.

b. The maximum working pressure with the nonmetallic ptfe and PVC lower housings is 150 psig regardless of the higher allowable flange pressure range.

#### Pressure Seals PSSCR and PSSCT

The maximum working pressure of the seal process connection varies with the clamping device used. Refer to Tri-Clover Tri-Clamp standards to determine the pressure limits of the clamping system that you are using.

#### PSSSR and PSSST (Sanitary Tank Spud) Seals

The maximum working pressure of mini tank spud seal is 1.55 MPa at 120°C (225 psi at 250°F). That of the standard tank spud seal is 1.38 MPa at 120°C (200 psi at 250°F).

### Origin Code

The origin code identifies the area of manufacture and the year and week of manufacture. See Item E on the example shown in Figure 1. In the example, 2A means the product was manufactured in the Measurement and Instrument Division, 01 identifies the year of manufacture as 2001, and 25, the week of manufacture in that year.

### **Operating Temperature Limits**

The operating temperature limits of the electronics are -40°C and +85°C (-40°F and +185°F). The limits are -40°C and +75°C (-40°F and +167°F) for IAP10, IGP10, IGP25, and IGP50 Transmitters with ATEX flameproof certification. Ensure that the transmitter is operated within this range.

The sensor body operating temperature limits are determined by the sensor fill fluid. The cover material, sensor diaphragm material and fill fluid are specified by two characters in the model code on the data plate. See Item A on the example shown in Figure 1. Also see Table 5 and Table 6 to interpret this part of the code and Table 7 to determine the sensor body temperature limits. In the example IDP10-D12A21E-A3, the number 12 identifies the fill fluid in Table 5 as silicone. Table 7 identifies silicone as having temperature limits of -46 and +121°C (-50 and +250°F).

Table 5. Interpretation of Model Code for IDP10, IAP20, IGP20, IDP25, and IDP50 Transmitters

Code	Cover Material	Sensor Diaphragm Material	Fill Fluid
10	Steel	Co-Ni-Cr	Silicone
11	Steel	Co-Ni-Cr	Fluorinert
12	Steel	316 ss	Silicone
13	Steel	316 ss	Fluorinert
16	Steel	Nickel alloy (a)	Silicone
17	Steel	Nickel alloy (a)	Fluorinert
20	316 ss	Co-Ni-Cr	Silicone
21	316 ss	Co-Ni-Cr	Fluorinert
22	316 ss	316 ss	Silicone
23	316 ss	316 ss	Fluorinert
2G	316 ss	316 ss, gold-plated	Silicone
24	316 ss	Monel	Silicone
25	316 ss	Monel	Fluorinert
26	316 ss	Nickel alloy (a)	Silicone
27	316 ss	Nickel alloy (a)	Fluorinert
34	Monel	Monel	Silicone
35	Monel	Monel	Fluorinert
46	Nickel alloy (a)	Nickel alloy (a)	Silicone
47	Nickel alloy (a)	Nickel alloy (a)	Fluorinert
48	Nickel alloy (a)	Tantalum	Silicone
49	Nickel alloy (a)	Tantalum	Fluorinert
78	pvdf Insert	Tantalum	Silicone
79	pvdf Insert	Tantalum	Fluorinert
F1	N/A - Used with pres	ssure seal	Silicone
F2			Fluorinert
F3			Silicone
F4			Fluorinert
S1			Silicone
S2			Fluorinert
S3			Silicone
S4			Fluorinert
S5			Silicone
S6			Fluorinert
SA			Silicone
SB		Inert	
SC		Silicone	
SD		Inert	
SE		Silicone	
SF			Inert

a. Equivalent to Hastelloy® C. Hastelloy is a registered trademark of Haynes International, Inc.

Table 6. Interpretation of Model Code for IAP10, IGP10, IGP25, and IGP50 Transmitters

Code	Process Connector Material	Sensor Diaphragm Material	Fill Fluid
20	316L ss	Co-Ni-Cr	Silicone
21	316L ss	Co-Ni-Cr	Fluorinert
22	316L ss	316L ss	Silicone
23	316L ss	316L ss	Fluorinert
24	15-5 ss	15-5	None
26	Inconel X-750	Inconel X-750	None
28	13-8Mo ss	13-8Mo ss	None
30	316L ss	Nickel alloy (a)	Silicone
31	316L ss	Nickel alloy (a)	Fluorinert
32	Nickel alloy (a)	Nickel alloy (a)	Silicone
33	Nickel alloy (a)	Nickel alloy (a)C	Fluorinert
TA	316L ss	316L ss	Neobee
T2	316L ss	316L ss	Neobee
T3	316L ss	316L ss	Neobee
ТВ	316L ss	Nickel alloy (a)	Neobee
T4	316L ss	Nickel alloy (a)C	Neobee
T5	316L ss	Nickel alloy (a)	Neobee
M1	316L ss	316L ss	Neobee
M6	316L ss	316L ss	Neobee
M9	316L ss	316L ss	Neobee
PX	316L ss	316L ss	Neobee
PZ	316L ss	316L ss	Neobee
PA	316L ss	316L ss	Silicone
РВ	316L ss	316L ss	Silicone
PC	316L ss	316L ss	Silicone
PD	316L ss	316L ss	Silicone
PE	316L ss	Nickel alloy (a)C	Silicone
PF	316L ss	Nickel alloy (a)	Silicone
PG	316L ss	Nickel alloy (a)	Silicone
PH	316L ss	Nickel alloy (a)	Silicone
PJ	316L ss	Nickel alloy (a)	Silicone
D1	N/A - Used with pressure seal		Silicone
D2			Fluorinert
S3			Silicone
S4			Fluorinert
SC			Silicone
SD			Inert

Table 7. Sensor Body Operating Temperature Limits for Models Listed in Tables 5 and 6

Limiting Factor	Temperature Limits
Silicone Fill Fluid	-46 and +121°C (-50 and +250°F)
Fluorinert Fill Fluid	-29 and +121°C (-20 and +250°F)
Neobee Fill Fluid	-18 and +204°C (0 and 400°F) (a) (b)
pvdf Inserts	-7 and +82°C (20 and 180°F)

a. At process connection.

For transmitters with pressure seals, the temperature limits at the seals are shown in Table 8. The pressure seal fill fluid code is found in the pressure seal model code as shown in the following examples (fill fluid code position is underlined and bolded):

PSFLT PSFLT-B2S0153

PSFPS and PSFESPSFPS-A2S01334E

PSFAR PSFAD-D232SSS2SBC<u>1</u>3M

PSFAD PSFAD-D232SS2SBC1

PSTAR PSTAR-B32USSS1BCC34F

PSTAD PSTAR-B32USSS1BCC3

PSISR PSISR-A23JSSS1SC<u>1</u>4M

PSISD PSISD-A23JSSS1SC1

PSSCR PSSCR-D21S3<u>5</u>4H

PSSCT PSSCT-B21S<u>5</u>5

PSSSR PSSSR-B4S23<u>5</u>4H

PSSST PSSST-B4S2<u>5</u>5

Table 8. Seal Fill Fluid and Operating Temperature Limits

		Temperature Limits		
Code	Fill Fluid	Direct Connected (a) (b) PSFLT, PSFAD, PSTAD, PSISD, PSSCT, PSSST	Remote Connected (b) PSFPS, PSFES, PSFAR, PSTAR, PSISR, PSSCR, PSSSR	
1	DC200, 10cS, Silicone	-40 and +204°C (-40 and +400°F)	-40 and +232°C (-40 and +450°F)	
2	FC77 Fluorinert	-59 and +82°C (-75 and +180°F)	-59 and +82°C (-75 and +180°F)	
3	DC200, 3cS, Silicone	-40 and +149°C (-40 and +300°F)	-40 and +149°C (-40 and +300°F)	
4	DC704 (HTF) Silicone	0 and +204°C (32 and 400°F)	0 and +304°C (32 and 580°F)	
5	Neob (c)	-18 and +204°C (0 and 400°F)	-18 and +204°C (0 and 400°F) (c)	

a. Limited to 204°C (400°F) maximum regardless of fill fluid due to transmitter maximum temperature limits.

PSSSR, PSSST, IGP10, IAP10, IGP25-.M with the EPDM O ring supplied are limited to a maximum temperature of 121°C (250°F).

b. PSFAR, PSFAD, PSTAR, PSTAD, PSISR, and PSISD seals with ptfe gaskets are limited to 60°C (140°F).

c. PSSSR, PSSST, IGP10, IAP10, IGP25-.M with the EPDM O ring are limited to a maximum temperature of 121°C (250°F).

#### **Process Wetted Materials**

Refer to Table 5 to determine if the process cover and sensor diaphragm material are suitable for the process. For transmitters with pressure seals, the seal wetted material is as follows:

Pressure Seals PSFLT, PSFPS, and PSFES

Table 9. Pressure Seal PSFLT, PSFPS, and PSFES Wetted Materials

Material Code	Material
S	316L ss
C	Nickel alloy (a)
T	Tantalum

a. Equivalent to Hastelloy® C.

The process wetted material code is found in the pressure seal model number which is located on the pressure seal. See following example:

PSFLT-B2**S**0153 SEAL WETTED MATERIAL

Pressure Seals PSFAR, PSFAD, PSTAR, PSTAD, PSISR, and PSISD

Table 10. Pressure Seal Lower Housing Materials

Material Code	Material
S	316 ss
K	Carbon Steel
С	Nickel alloy (a)
Т	Tantalum Plate
E	Titanium Grade 4
L	Inconel 600
М	Monel 400
N	Nickel 200
G	Glass Filled ptfe
Р	Polyvinyl Chloride

a. Equivalent to Hastelloy® C.

Material Code	Material
S	316L ss
С	Nickel alloy (a)
Т	Tantalum
E	Titanium Grade 2
L	Inconel 600
М	Monel 400

Table 11. Pressure Seal Diaphragm Materials


Nickel 200

Table 12. Pressure Seal Gasket Materials

Material Code	Material
S	Organic Fiber with Nitrile Binder
3	Silver Plated 316 ss
Т	ptfe
В	Buna N
V	Viton
G	Grafoil
Т	Silver Plated Nickel alloy (a)

a. Equivalent to Hastelloy® C.

 The material codes are found in the pressure seal model number which is located on the pressure seal. See following example:



#### Pressure Seals PSSCR

Table 13. Pressure Seal PSSCR Diaphragm Materials

Material Code	Material
	316L ss Nickel alloy (a)

a. Equivalent to Hastelloy® C276.

a. Equivalent to Hastelloy® C276.

The diaphragm material code is found in the pressure seal model number which is located on the pressure seal. See following example:

> PSSCR-D21S354H □ DIAPHRAGM MATERIAL

The housing material is 316 ss. The gasket is provided by the user.

#### Pressure Seals PSSCT

The housing material is 316 ss. The diaphragm material is 316L ss. The gasket is provided by the user.

#### Pressure Seals PSSSR and PSSST

The housing material is 316 ss. The diaphragm material is 316L ss. The gasket material is EPDM.

### Warnings

### General Warning



#### **WARNING** -

- 1. Transmitters must be installed to meet all applicable local installation regulations, such as hazardous location requirements, electrical wiring codes, and mechanical piping codes. Persons involved in the installation must be trained in these code requirements to ensure that the installation takes maximum advantage of the safety features designed into the transmitter.
- 2. A plug is supplied with each transmitter with 1/2 NPT conduit connection. It is intended to provide moisture ingress protection of the unused housing conduit entry. The plug must be wrench tight to achieve this level of protection. Thread sealant is required. Explosion-proof applications may require a certified plug. Housings with M20 / PG 13.5 threaded conduit connections are provided with an ATEX certified plug. Thread sealant is required to provide moisture ingress protection.

### **ATEX Warnings**



#### **WARNING**

Apparatus marked as Category 1 equipment and used in hazardous areas requiring this category must be installed in such a way that, even in the event of rare incidents, the versions with an aluminum alloy enclosure can not be an ignition source due to impact and friction.

Install ATEX certified transmitters in accordance with the requirements of standard EN 60079-14.



#### ─▲ WARNING

To install a transmitter labeled with multiple approvals, select and permanently mark the certification label in the tick block to distinguish the installed approval type from the unused approval types. Once installed, the transmitter cannot be reinstalled using any other approval type. Not following these instructions will jeopardize explosion safety.

On IGPxx and IAPxx Transmitters with IECEx certification, the maximum constructional gap (I<sub>c</sub>) is less than that required by IEC 60079-1:2003 as detailed in the table below:

Flamepath	Maximum Gap (mm)
Transducer / Plug Low	0.04
Lid / Window Spigot (flat part)	0.04

### Explosionproof/Flameproof and Enclosure Warning



#### ─▲ WARNING •

- 1. To prevent possible explosion and to maintain explosion proof/flameproof and dustignitionproof protection, plug unused openings with a certified metal pipe plug. For 1/2 NPT connections, both the plug and conduit must be engaged a minimum of five full threads. For M20 and PG 13.5 connections, the certified plug provided and the conduit must be engaged a minimum of seven full threads.
- 2. The threaded housing covers must be installed. Turn covers to seat O-ring into the housing and then continue to hand tighten until the cover contacts the housing metal-to-metal.
- 3. If the electronics housing is removed for any reason, it must be hand tightened fully. Then engage the set screw until it bottoms out and back it off 1/8th turn. Fill the set screw recess with red lacquer (Foxboro Part Number X0180GS or equivalent). The housing then may be rotated up to one full turn in a counterclockwise direction for optimum access to adjustments.

### Intrinsically Safe and Type n Warning



#### **─ !** WARNING -

Since live maintenance is not specified, to prevent ignition of flammable atmospheres, disconnect power before servicing unless the area is certified to be nonhazardous.

### Type n Warning

#### ─▲ WARNING \*

On transmitters certified for ATEX protection n, CSA Class I, Division 2, or FM nonincendive for Class I, Division 2, the threaded housing covers must be installed.

### **Pressure Warnings**



#### ■ WARNING \*

When installing your transmitter, tighten process connector bolts to a torque of 61 N•m (45 ft•lb) and drain plugs and optional vent screws to 20 N•m (15 ft•lb). See Figure 3.

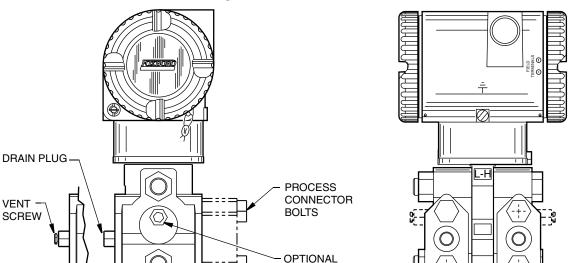


Figure 3. Pressure Connections



#### WARNING

If a sensor is replaced or process covers are rotated for venting, replace the gaskets and torque cover bolts (see Figures 4 and 5) to 100 Nom (75 ftolb) in several even increments. Torque values are 66 N•m (50 ft•lb) when optional 316 ss bolts are specified (option B1). A pressure test is required. Perform a hydrostatic test with a liquid following proper hydrostatic test procedures. Pressure test the process cover assembly by applying a hydrostatic pressure of 150% of the maximum static and overrange pressure rating to both sides of the process cover/sensor assembly simultaneously through the process connections. Hold pressure for one minute. There should be no leakage of the test fluid through the gaskets.

**VENT SCREW** OR DRAIN PLUG

Figure 4. Sensor Replacement


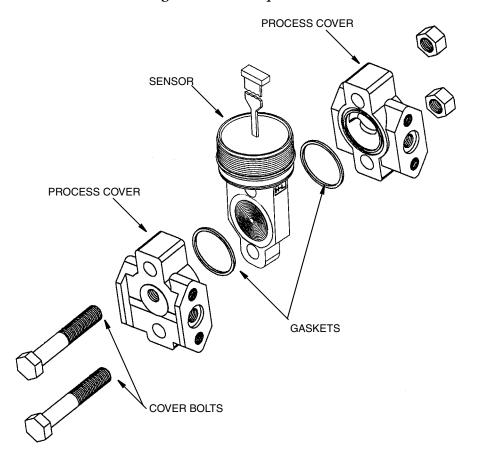


Figure 5. Sensor Replacement (pvdf Inserts)



### **Process Fluid Warning**

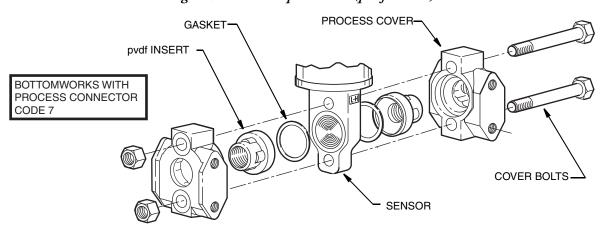

#### **─ !** WARNING

If process containing parts are to be disassembled:

- 1. Make sure that process fluid is not under pressure or at high temperature.
- 2. Take proper precautions concerning leakage or spillage of any toxic or otherwise dangerous fluid. Follow any Material Safety Data Sheet (MSDS) recommendations.

### Seal or Sensor Fill Fluid Warning



#### **─!** WARNING -

Even though the volume of fill fluid is small, be sure that the fill fluid can mix safely with the process fluid.

### Parts Replacement Warning



#### ─ ⚠ WARNING -

This product contains components that have critical safety characteristics. Do **not** substitute components. Replace components only with identical factory supplied components. Component substitution may impair the electrical safety of this equipment and its suitability for use in hazardous locations.

## **EC** Declaration of Conformity

We, Manufacturer:

Invensys Systems, Inc. 38 Neponset Ave. Foxboro, Massachusetts 02035 U.S.A.

declare under our sole responsibility that the

I/A Series Pressure Transmitters IGP, IAP, IDP, IPI, IMV

are in conformity with the protection requirements of Council Directives:

- ♦ 2004/108/EC on the approximation of the laws of the Member States relating to Electromagnetic Compatibility
- 94/9/EC on the approximation of the laws of the Member States concerning equipment and protective systems intended for use in potentially explosive atmospheres
- ◆ 97/23/EC on the approximation of the laws of the Member States concerning pressure equipment

The basis on which Conformity is being declared:

- ♦ EN 61326-1:2006, Electrical equipment for measurement, control and laboratory use EMC requirements, Class A emission limits, and immunity requirements according to Table 2 for Industrial locations.
- ♦ EN50014 1997 A1 1999 A2 1999 Electrical apparatus for potentially explosive atmospheres 'General Requirements'.
- ♦ EN50018 2000 Electrical apparatus for potentially explosive atmospheres 'Flameproof enclosures 'd''.
- ♦ EN50020 1995 Electrical apparatus for potentially explosive atmospheres 'Intrinsic safety 'I''.
- ♦ EN50021 1999 Electrical apparatus for potentially explosive atmospheres 'Type of protection 'n''.
- ♦ EN50284 1999 Special requirements for construction, test and marking of electrical apparatus of group II Category 1 G.
- ♦ EN 50281-1-1 1999 Electrical apparatus for use in the presence of combustible dust.
- ♦ EN 60079-15 2003 Electrical apparatus for explosive gas atmospheres Part 15: Electrical apparatus with type of protection "n"

For compliance with ATEX, products are in accordance with EC Type Examination Certificates KEMA 00ATEX 1060X, KEMA 00ATEX 2019X and KEMA 00ATEX 1009X, issued by KEMA Quality B.V., Ultrechtseweg 310, 6812 AR Arnhem, The Netherlands, Notified Body number 0344, and with EC Type Examination Certificates SIRA 04ATEX1349, SIRA 04ATEX2335X, SIRA 06ATEX4056X, SIRA 06ATEX2055X, and SIRA 06ATEX4019X, issued by Sira Certification Service, Rake Lane, Eccleston, Chester, CH4 9JN, England, Notified Body number 0518. The authorized markings for each certificate are shown below. The actual ATEX markings on the product vary according to model code. Refer to Product Specification Sheet and marking on product for details pertaining to individual model codes.

KEMA 00ATEX1060X II 3 G EEx nL IIC T4 ... T6

II 1 GD EEx nL IIC T4 ... T6 T 135°C

KEMA 00ATEX1009X II 1 G EEx ia IIC T4 ... T6

II 1/2 G EEx ib IIC T4 ... T6

II 1 GD EEx ia IIC T4 ... T6 T 135°C

II 1/2 GD EEx ib IIC T4 ... T6 T 135°C

KEMA 00ATEX2019X II 2 G EEx d IIC T6

II 2 GD EEx d IIC T6 T 85°C

SIRA 04ATEX1349 II 2 GD EEx d IIC T6 T 85°C

SIRA 04ATEX2335X II 1G EEx ia IIC T4

SIRA 06ATEX4056X II 3 GD EEx nL IIC T4

SIRA 06ATEX2055X II 1 GD EEx ia IIC T4

SIRA 06ATEX4019X II 3 G EEx nL IIC T4

For the Pressure Equipment Directive, conformity is based on a certificate issued by DNV GL, Veritasveien 1, 1322 HOVIK, Norway, Notified Body number 0575, based on Maximum Working Pressure (MWP). Conformity Assessment Module "H" is applied for Models IGP, IAP, IMV and IDP where the MWP is greater than 200 bar. The applicable design standard is IEC/EN 61010-1.

## 2. Installation

### —! CAUTION

To avoid damage to the transmitter sensor, do not use any impact devices, such as an impact wrench or stamping device, on the transmitter.

#### — NOTE

- 1. The transmitter should be mounted so that any moisture condensing or draining into the field wiring compartment can exit through one of the two threaded conduit connections.
- 2. Use a suitable thread sealant on all connections.
- 3. If the transmitter is not installed in the vertical position, readjust zero output to eliminate the position zero effect.

### Mechanical Installation

#### Differential Pressure Transmitter

The IDP10, IDP25, and IDP50 differential pressure transmitters can be supported by the process piping (Figure 6), on a bypass manifold (Figures 7 through 10), or mounted to a vertical or horizontal pipe or surface using an optional mounting bracket (Figures 11 through 16). For dimensional information, refer to DP 020-446.

#### - NOTE

- 1. The IDP25 and IDP50 transmitters are only available in the Traditional Structure at this time.
- 2. If the transmitter is not installed in the vertical position, readjust zero output to eliminate the position zero effect.
- 3. When pvdf inserts (structure codes 78/79) are used, the process connection must be made directly to the pvdf inserts in the Hi and Lo side process covers.
- 4. The transmitter should be mounted so that any moisture condensing or draining into the field wiring compartment can exit through one of the two threaded conduit connections.

#### Process-Mounted Transmitter

Figure 6 shows the transmitter mounted to and supported by the process piping.

TRADITIONAL STRUCTURE

LP1 STRUCTURE

LP2 STRUCTURE

NOTE

NOTE


#### Figure 6. Typical Mounting of an IDP Transmitter Supported by Process Piping

NOTE: MARK INDICATING LOW AND HIGH PRESSURE SIDE OF TRANSMITTER

#### Manifold Mounted Transmitter

Figure 7 shows the transmitter mounted to and supported by a bypass manifold. Figures 8 and 9 show a bypass manifold mounted to a DN50 (2 inch) pipe with an optional mounting bracket.


Figure 7. Typical Mounting of an IDP Transmitter Supported by a Bypass Manifold

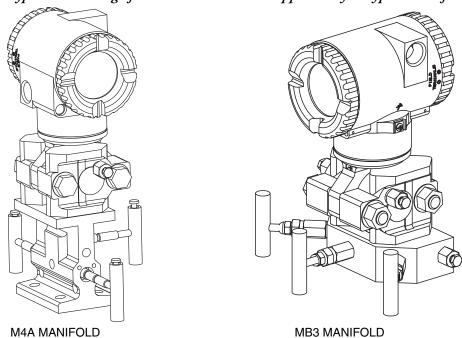

PROCESS CONNECTORS SUPPLIED WITH PROCESS TRANSMITTERS) CONNECTIONS MOUNTING 0 0 BRACKET MOUNTING **BRACKET** TRANSMITTER TRANSMITTER CONNECTIONS CONNECTIONS M4A MANIFOLD M4T MANIFOLD

Figure 8. Typical Mounting of M4A and M4T Manifold with -AM Bracket



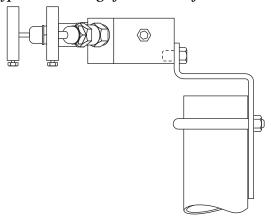

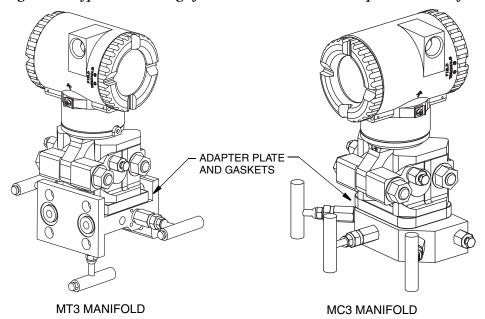


Figure 10. Typical Mounting of IMV25 Transmitter on Coplanar™ Manifold

### Pipe- or Surface-Mounted Transmitter

To mount the transmitter to a pipe or surface, use the Standard Mounting Bracket Set (Model Code Option -M1 or -M2) or Universal Bracket Mounting Set (Model Code Option -M3).


#### **Standard Mounting Bracket**

The transmitter (with either traditional or LP2 low-profile structures) can be mounted to a vertical or horizontal, DN 50 or 2-in pipe using a standard bracket. See Figure 11 for details and Figure 12 for examples of different situations. Secure the mounting bracket to the transmitter using the four screws provided. Mount the bracket to the pipe. To mount to a horizontal pipe, turn the U-bolt 90° from the position shown in Figure 11. The mounting bracket can also be used for wall mounting by securing the bracket to a wall using the U-bolt mounting holes.

APPROXIMATELY 3 IN CLEARANCE REQUIRED FOR ACCESS TO MOUNTING BOLTS AND VENT SCREW. FOR SURFACE MOUNTING, REPLACE U-BOLT WITH TWO 0.375 IN DIAMETER BOLTS OF SUFFICIENT LENGTH TO OPTIONAL SIDE VENT PASS THROUGH BRACKET AND SURFACE VERTICAL DN 50 OR 2 IN PIPE BRACKET SHOWN. ROTATE U-BOLT 90° FOR MOUNTING TO HORIZONTAL PIPE

Figure 11. Pipe or Surface Mounted Transmitter Using a Standard Bracket

Figure 12. Examples of Mounting With a Standard Bracket

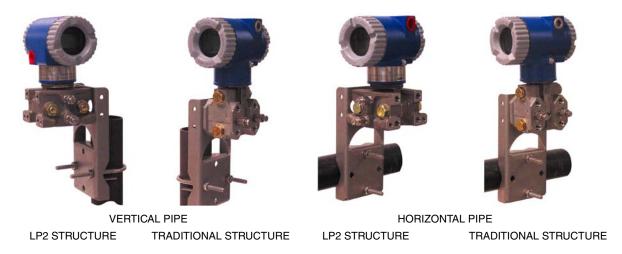

#### **Universal Mounting Bracket**

The transmitter (with either traditional or LP2 low-profile structure) can be mounted in a myriad of positions to a vertical or horizontal, DN 50 or 2-in pipe using a universal bracket. See Figure 13 for details of a universal bracket and Figure 14 through Figure 16 for examples of different mounting situations. Secure the mounting bracket to the transmitter using the two long or four short screws provided. Mount the bracket to the pipe. The mounting bracket can also be used for wall mounting by securing the bracket to a wall using the U-bolt mounting holes.

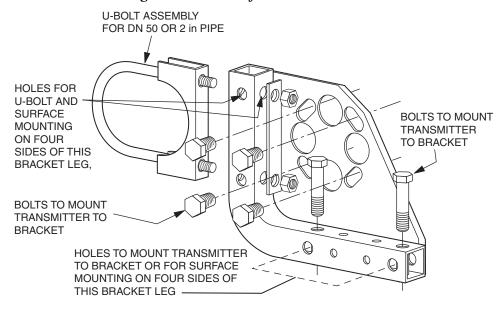


Figure 13. Details of a Universal Bracket

Figure 14. Mounting a Transmitter with Traditional Structure Using a Universal Bracket

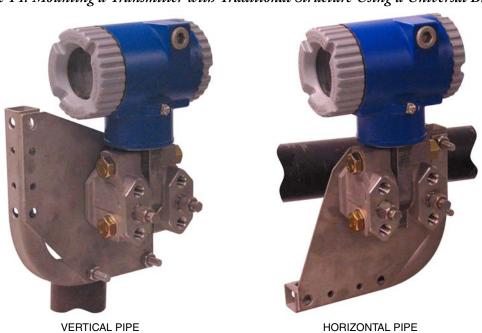


Figure 15. Vertical Pipe Mounting a Transmitter with LP2 Structure Using a Universal Bracket



Figure 16. Horizontal Mounting a Transmitter with LP2 Structure Using a Universal Bracket



### Venting and Draining

#### **Traditional Structure**

Sensor cavity venting and draining is provided for both vertical and horizontal mounting. For vertical mounted units, draining is via a drain screw shown in Figure 17 and venting is possible with side vents (Option Code -V) shown in Figure 18. For horizontal mounted units, the unit is self draining and venting is via a vent screw shown in Figure 19.

Figure 17. Vertical Mounting - Cavity Draining

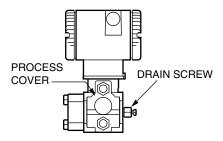


Figure 18. Vertical Mounting - Cavity Venting


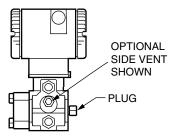


Figure 19. Horizontal Mounting - Cavity Venting

 

#### **LP1 Low Profile Structure**

Sensor cavity venting and draining is provided for both vertical and horizontal mounting. For vertical mounted units, the transmitter is self draining and venting is via a vent screw shown in Figure 20. For horizontal mounted units, the transmitter can simply be 'turned over' (rotated 180 degrees) as shown in Figure 21 to orient the high and low pressure sides in the preferred locations. There is no need to unbolt the process covers. If the transmitter is connected with a length of impulse piping, such piping should slope up to the transmitter for gas applications and down for liquid applications.

Figure 20. Vertical Mounting - Cavity Venting

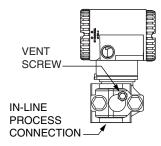



Figure 21. Horizontal Mounting - Cavity Venting and Draining



#### **LP2 Low Profile Structure**

The transmitter with LP2 low profile structure had a full-featured vent and drain design with separate vent and drain screws positioned in each cover for complete venting and draining from the sensor cavity when installed in the upright position. See Figure 22.

Figure 22. Cavity Venting and Draining

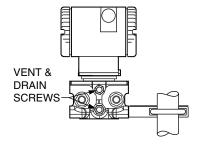

### Installation of Flow Measurement Piping

Figure 23 and Figure 24 show typical installations with horizontal and vertical process pipes.

The transmitters are shown below the level of the pressure connections at the pipe (usual arrangement, except for gas flow without a seal liquid), and with filling tees in the lines to the transmitter (for a seal liquid).

If the process fluid being measured must not come in contact with the transmitter, the transmitter lines must be filled with a suitable seal liquid (see procedure in next section). In such a case, the transmitter must be mounted below the level of the pressure connections at the pipe. With steam flow, the lines are filled with water to protect the transmitter from the hot steam. The seal liquid (or water) is added to the lines through the filling tees. To prevent unequal heads on the transmitter, the tees must be at the same elevation (as shown in Figure 23) and the transmitter must be mounted vertically (as shown). If a seal liquid is not required, elbows can be used in place of the tees.

Tighten drain plugs and optional vent screws to 20 N·m (15 lb·ft). Tighten the four process connector bolts to a torque of 61 N·m (45 lb·ft).

Note that the low and high pressure sides of the transmitter are identified by an L-H marking on the side of the sensor above the warning label.

With medium-viscosity seal liquids and/or long transmitter lines, larger valve sizes should be used.

#### - NOTE

- 1. With a **horizontal** line, pressure connections at the pipe should be at the side of the line. However, with gas flow without a seal liquid, connections should be at the top of the line.
- 2. With a **vertical** line, flow should be upwards.
- 3. For **liquid** or **steam** flow, the transmitter should be mounted **lower** than the pressure connections at the pipe.
- 4. For **gas** flow **without** a seal liquid, the transmitter should be mounted **above** the pressure connections at the pipe; for **gas** flow **with** a seal liquid, the transmitter should be mounted **below** the pressure connections.
- 5. It is recommended that snubbers are used in installations prone to high levels of fluid pulsations.

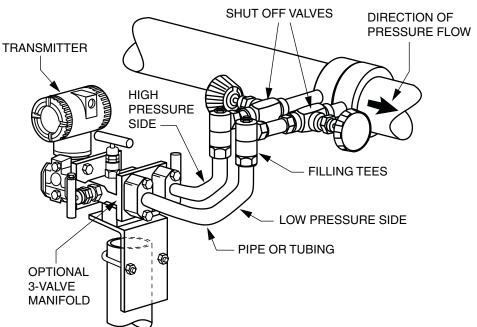


Figure 23. Example of Horizontal Process Line Installation

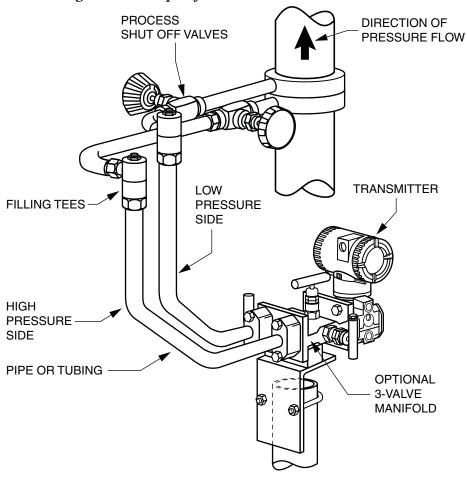


Figure 24. Example of Vertical Process Line Installation

### Filling System with Seal Liquid

If the process fluid being measured must not come in contact with the transmitter, the transmitter lines must be filled with a suitable seal liquid. The procedure to do this is as follows:

- 1. If the transmitter is in service, follow the procedure for "Taking a Differential Pressure Xmtr Out of Operation" on page 62.
- 2. Close both process shutoff valves.
- 3. Open all three valves on 3-Valve Manifold.
- 4. Partially open the vent screws on the transmitter until all air has been forced out of the transmitter body and lines. Close the vent screws.
- 5. Refill the tee connections. Replace the plugs and close the bypass valve. Check for leaks.
- 6. Follow the procedure for "Putting a Differential Pressure Xmtr Into Operation" on page 61.



#### ! CAUTION

To prevent loss of seal liquid and contamination of process fluid, never open both process shutoff valves and manifold shutoff valves if the bypass valve is open.

## Absolute and Gauge Pressure Transmitter

### -! CAUTION

For 3-A compliant sanitary applications (Models IGP10, IAP10, IGP25-..T, -..M....)

Process wetted surface (diaphragm convolutions) should be installed so that process does not pool between convolutions when the vessel is empty.

The transmitter should be mounted in such a way that nonprocess wetted surfaces are self draining. It should be installed horizontal to vertical, so that the crevice at the feature where the housing is attached to the sensor (neck) is self draining.

The design of these devices does not comply with paragraph D10.1.2 for 3-A standard 74-xx compliance.


### IAP10, IGP10, IGP25 and IGP50 Transmitters

These pressure transmitters can be directly connected to the process using the 1/2 NPT external thread or mounted to a vertical or horizontal pipe or a surface using the Optional Mounting Set (Model Code Option -M1 through -M6) as shown in Figure 25.

#### - NOTE

- 1. Do **not** direct mount these transmitters to the process using the 1/4 NPT internal thread. This thread should only be used to connect to the process when the transmitter is mounted with the optional mounting set.
- 2. Do not mount these transmitters using the conduit connection and optional mounting set when vibration conditions exceed 20 m/s2 (2 "g").

Figure 25. IAP10, IGP10, IGP25, and IGP50 Transmitter Mounting

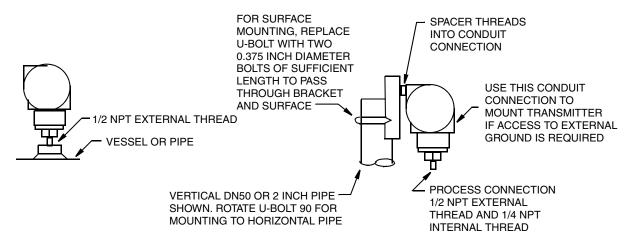

#### IAP20 and IGP20 Transmitters

To mount these transmitter to a pipe or surface, use the Optional Mounting Set (Model Code Option -M1 or -M2). Referring to Figure 26, secure the mounting bracket to the transmitter using the two screws provided. Mount the transmitter with the mounting bracket to a vertical or horizontal DN50 or 2-inch pipe. To mount to a horizontal pipe, turn the U-bolt 90° from the position shown in Figure 26. The mounting bracket can also be used for wall mounting by securing the bracket to a wall using the U-bolt mounting holes.

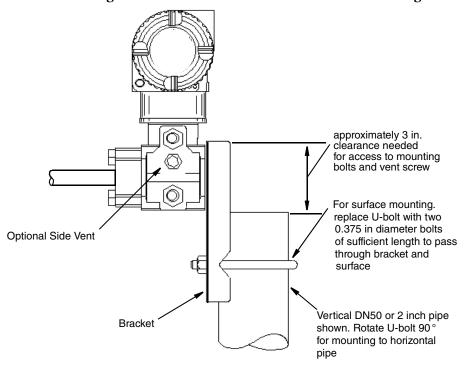


Figure 26. IAP20 and IGP20 Transmitter Mounting

#### - NOTE

When structure codes 78/79 are used (pvdf insert), the process connection must be made directly to the pvdf insert in the process cover.

### Typical Transmitter Piping

Figure 27 shows a typical piping application. Calibration supply pressure can be applied via a calibration tee or calibration screw. The lower conduit port can be used as a drain for moisture buildup in terminal compartment. For Model IAP20, IGP20, IGP25, and IGP50 Transmitters, tighten the process connector bolts to a torque of 61 N·m (45 lb·ft) and drain plugs and vent screws to a torque of 20 N·m (15 lb·ft).

#### - NOTE

- 1. It is recommended that snubbers are used in installations prone to high levels of fluid pulsations.
- 2. IAP10, IGP10, IGP25, and IGP50 Transmitters mounted directly to process piping or a pressure vessel as shown in Figure 27, could require the use of a shutoff valve (shown) to comply with the requirements of ASME Power Piping Code B31.1 and Chemical and Petroleum Piping Code B31.3.

Figure 27. Typical Transmitter Piping (IGP10 shown)

TRANSMITTER


LOWER CONDUIT PORT

CALIBRATION TEE

BLOCK AND BLEED VALVE
(SHUTOFF)

For hot process applications above the operative limits of your transmitter [121 °C (250 °F)], such as steam, additional piping is required to protect the transmitter from the hot process. See Figure 28. The piping is filled with water or process fluid. Mount the transmitter below the pressure connection at the pipe. Although the transmitter is shown mounted vertically, you can also mount it horizontally unless sediment is present. The calibration tee is not required if a calibration screw is used for field calibrations.

If trapped vapor pockets cannot be tolerated in a liquid service and a horizontal process connection is used, install a pipe elbow and vertically position the transmitter with the housing below the process connection.

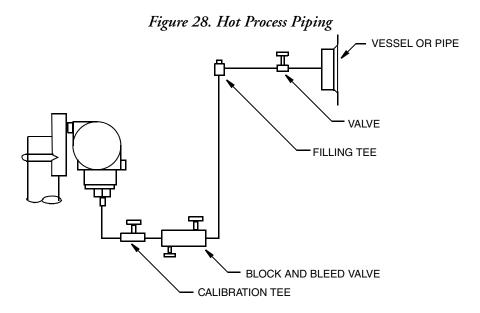

### Transmitter with Seals

For information on transmitters with seals, refer to MI 029-369 on your DVD. Capillary fill fluid specific gravities are given in Table 14 for your convenience.


Fill Fluid Code	Fill Fluid	Specific Gravity at 21°C (70°F)
1	DC200, 10cS, Silicone	0.94
2	FC77 Fluorinert	1.78
3	DC200, 3cS, Silicone	0.90
4	DC704 (HTF) Silicone	1.07
5	Neobee	0.92

Table 14. Capillary Fill Fluid Specific Gravities

## Positioning the Housing

The transmitter housing (topworks) can be rotated up to one full turn in the counterclockwise direction when viewed from above for optimum access to adjustments, display, or conduit connections. Housings have either an anti-rotation screw or a retention clip that prevent the housing from being rotated beyond a safe depth of housing/sensor thread engagement.

Figure 29. Housing Screw or Clip Location

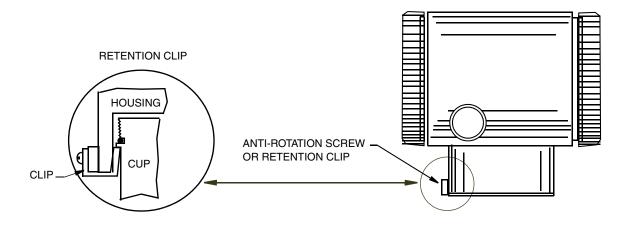

## Positioning the Display

The display (optional in some models) can be rotated within the housing to any of four positions at 90° increments. To do this with the optional removable display, grasp the two tabs on the display and rotate it about 10° in a counterclockwise direction. Pull out the display. Ensure that the O-ring is fully seated in its groove in the display housing. Turn the display to the desired position, reinsert it in the electronics module, aligning the tabs on the sides of the assembly, and twist it in the clockwise direction. With electronics versions -A and -V, the display is a standard part of the electronics module and can be rotated by repositioning the entire module, using the mounting screws.



Do **not** turn the display more than 180° in any direction. Doing so could damage its connecting cable.

## Setting the Write Protect Jumper

#### – NOTE

This feature only applies to transmitters with FoxCom (Code -D), HART (Code -T), and FOUNDATION fieldbus (Code -F) electronics.

If your transmitter has write protection capability, it means that the external zero, local display, and remote communications can be prevented from writing to the electronics. Write protection is set by moving a jumper that is located in the electronics compartment behind the optional display. To activate write protection, remove the display as described in the previous section, then remove the jumper or move it to the lower position as shown on the exposed label. Replace the display.

### Cover Locks

Electronic housing cover locks, shown in Figure 30, are provided as standard with certain agency certifications and as part of the Custody Transfer Lock and Seal option. To lock the covers, unscrew the locking pin until approximately 6 mm (0.25 in) shows, lining up the hole in the pin with the hole in the housing. Insert the seal wire through the two holes, slide the seal onto the wire ends and crimp the seal.

## Wiring

The installation and wiring of your transmitter must conform to local code requirements.

#### — NOTE

Although surge protection is standard, it is recommended that transient/surge protection is used in installations prone to unusually high levels of electrical transients and surges.

For access to the field terminals, thread the cover lock (if present) into the housing to clear the threaded cover and remove the cover from the field terminals compartment as shown in Figure 30. Note that the embossed letters FIELD TERMINALS identify the proper compartment.

Figure 30. Accessing Field Terminals

1/2 NPT, PG 13.5 OR M20 CONDUIT CONNECTION FOR CUSTOMER WIRING. ONE ON OPPOSITE SIDE ALSO. PLUG UNUSED OPENING WITH metal PLUG PROVIDED (OR EQUIVALENT).

REMOVE COVER TO ACCESS WIRING TERMINALS.


COVER LOCK (2) (IF PRESENT)

48

## 4 to 20 mA Output Signal (Model Codes -A, -D, and -T)

The field terminals on a transmitter with a 4 to 20 mA output signal are shown in Figure 31.

Figure 31. Identification of Field Terminals

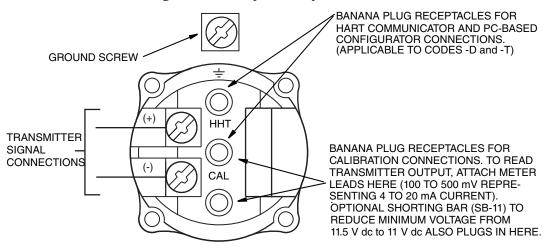

The transmitter is equipped with an internal ground connection within the field wiring compartment and an external ground connection at the base of the electronics housing. To minimize galvanic corrosion, place the wire lead or terminal between the captive washer and loose washer on the external ground screw.

When wiring a transmitter with 4 to 20 mA output signal, the supply voltage and loop load must be within specified limits. The supply output load vs. voltage relationship is:

 $R_{MAX} = 47.5 \text{ (V - 11.5)}$  and is shown in Figure 32.

#### - NOTE

The relationship when the optional shorting bar is used is:

 $R_{MAX} = 46.8 \text{ (V - 11)}.$ 

Any combination of supply voltage and loop load resistance in the shaded area can be used. To determine the loop load resistance (transmitter output load), add the series resistance of each component in the loop, excluding the transmitter. The power supply must be capable of supplying 22 mA of loop current.

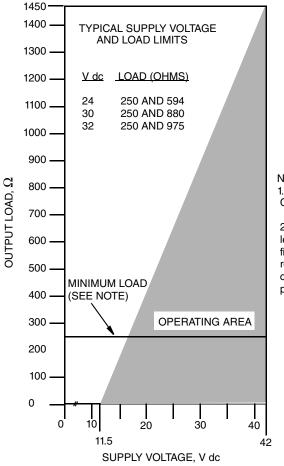


Figure 32. Supply Voltage and Loop Load

#### NOTES:

- 1.The minimum load for the PC-Based Configurator, or HART Communicator is 250  $\Omega$ .
- 2. The transmitter can function with an output load less than the minimum, provided that a remote con figurator is **not** connected to it. Connecting a remote configurator while operating in this area could cause output disturbances and/or communication problems.

### **Examples:**

- 1. For a loop load resistance of 880  $\Omega$ , the supply voltage can be any value from 30 to 42 V dc.
- 2. For a supply voltage of 24 V dc, the loop load resistance can be any value from 250 to 594  $\Omega$  with remote communications and zero to 594  $\Omega$  without remote communications.

To wire one or more transmitters to a power supply, proceed with the following steps.

- 1. Remove the cover from the transmitter field terminals compartment.
- 2. Run signal wires (0.50 mm<sup>2</sup> or 20 AWG, typical) through one of the transmitter conduit connections as shown in Figure 30. Use twisted pair to protect the 4 to 20 mA output and/or remote communications from electrical noise. Maximum recommended length for signal wires is 1800 m (6000 ft)

#### - NOTE

Do not run transmitter wires in same conduit as mains (ac power) wires.

3. If shielded cable is used, ground (earth) the shield at the receiver **only**. Do not ground the shield at the transmitter. Cut or tape the shield so that it cannot contact the metal housing.

- 4. Plug the unused conduit connection with the metal plug provided (or equivalent). To maintain specified explosion proof and dust-ignition proof protection, the plug must engage a minimum of five full threads.
- 5. Connect a ground wire to the ground terminal in accordance with local practice.



#### — ! CAUTION

If the signal circuit must be grounded, it is preferable to do so at the negative terminal of the dc power supply. To avoid errors resulting from ground loops or the possibility of short-circuiting groups of instruments in a loop, there should be only one ground in a loop.

- 6. Connect the power supply and receiver loop wires to the "+" and "-" terminal connections shown in Figure 31.
- 7. Connect receivers (such as controllers, recorders, indicators) in series with power supply and transmitter as shown in Figure 33.
- 8. Install the cover onto the transmitter. Turn covers to seat O-ring into the housing and then continue to hand tighten until the cover contacts the housing metal-to-metal. If cover locks are present, refer to "Cover Locks" on page 48.
- 9. If wiring additional transmitters to the same power supply, repeat Steps 1 through 8 for each additional transmitter. The setup with multiple transmitters connected to a single power supply is shown in Figure 34.
- 10. The PC-Based Configurator can be connected in the loop between the transmitter and the power supply as shown in Figure 33 and Figure 34 (not applicable with Version -A). Note that a minimum of 250  $\Omega$  must separate the power supply from the PC-Based Configurator or HART Communicator).

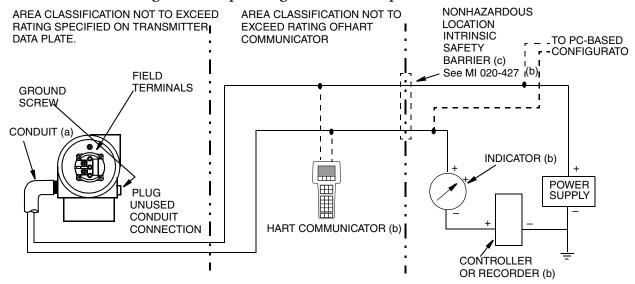


Figure 33. Loop Wiring 4 to 20 mA Output Transmitters

- (a) Run conduit down to avoid moisture buildup in terminals compartment.
- (b) There must be at least 250  $\Omega$  total resistance between the PC-Based Configurator OR HART Communicator and the Power Supply).
- (c) Transmitters with -A Electronics are not designed for use with Intrinsic Safety Barriers.

Warning

dIFFERENT versions of the HART Communicator may be suitable for DIFFERENT classifications (for example, Division 1 OR DIVISION 2). Check the rating of the version you have before using it in a hazardous area. Locating or connecting a HART Communicator in a hazardous area for which it is not certified could result in an explosion.

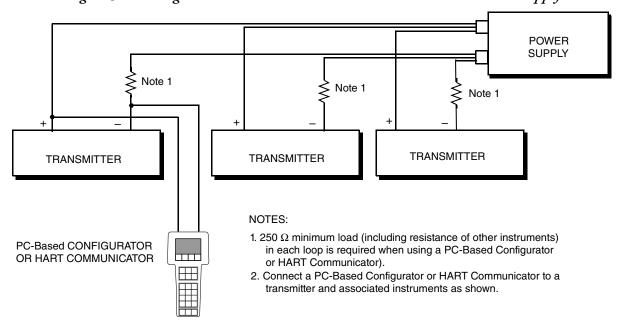


Figure 34. Wiring Several 4 to 20 mA Transmitters to a Common Power Supply

The transmitters with FoxCom (-D) and HART (-T) communications also communicate digitally with the PC-Based Configurator and the HART Communicator respectively at distances up to 1800 m (6000 ft). Communication between the remote configurator and the transmitter does not disturb the 4 to 20 mA output signal.

## HART Multidrop Wiring (Model Code -T)

"Multidropping" refers to the connection of several transmitters to a single communications transmission line. Communications between the host computer and the transmitters takes place digitally with the analog output of the transmitter deactivated. With the HART communications protocol, up to 15 transmitters can be connected on a single twisted pair of wires or over leased telephone lines.

The application of a multidrop installation requires consideration of the update rate necessary from each transmitter, the combination of transmitter models, and the length of the transmission line. Multidrop installations are not recommended where intrinsic safety is a requirement. Communication with the transmitters can be accomplished with any HART compatible modem and a host implementing the HART protocol. Each transmitter is identified by a unique address (1-15) and responds to the commands defined in the HART protocol.

Figure 35 shows a typical multidrop network. Do not use this figure as an installation diagram. Contact the HART Communications Foundation (telephone 512-794-0369 in the U.S.) with specific requirements for multidrop applications.

HOST MODEM

LOAD

POWER
SUPPLY

IDP10-T

IDP10-T

Figure 35. Typical Multidrop Network


The HART Communicator can operate, configure, and calibrate transmitters with HART communication protocol in the same way as it can in a standard point-to-point installation.

#### - NOTE

Transmitters with HART communication protocol are set to poll address 0 (POLLADR 0) at the factory, allowing them to operate in the standard point-to-point manner with a 4 to 20 mA output signal. To activate multidrop communication, the transmitter address must be changed to a number from 1 to 15. Each transmitter must be assigned a unique number on each multidrop network. This change deactivates the 4 to 20 mA analog output.

## 1 to 5 V dc Output Signal (Model Code -V)

The field terminals on a transmitter with a 1 to 5 V dc output signal are shown in Figure 36.

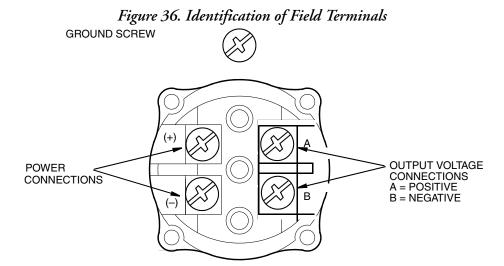

The transmitter is equipped with an internal ground connection within the field wiring compartment and an external ground connection at the base of the electronics housing. To minimize galvanic corrosion, place the wire lead or terminal between the captive washer and loose washer on the external ground screw.

### Power Supply Voltage and Current

The power supply voltage across the transmitter input terminals can be any value between 9 and 15.5 V dc and the power supply must be capable of supplying 3 mA of current under all conditions. Verify that the power supply loop load resistance and source impedance allow at least 9 V dc across the transmitter input terminals with a current draw of 3 mA.

### Output Load


The receiver input impedance can be any value between 1 and 10 M $\Omega$ 

#### Three or Four Wire Connections

The transmitter is supplied with a four-wire terminal block with the two negative terminals (- and B) electrically connected internally. This means that the transmitter can be wired with either three wires for wiring economy or four wires for maximum accuracy.


For relatively short wiring runs having low resistance, three-wire connections as shown in Figure 37 can be used to minimize wiring costs. However, a voltage drop in the common lead carrying the power supply current causes an error in the 1 to 5 V dc signal.

Figure 37. Three-wire Connection

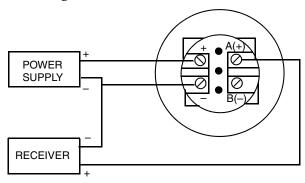

For wiring runs with high resistance due to long lengths or other reasons) or for maximum accuracy, a four-wire connection as shown in Figure 38 can be used to provide input-output isolation. With four-wire configuration, voltage drop in the power supply loop does not affect measurement accuracy.

Figure 38. Four-wire Connection

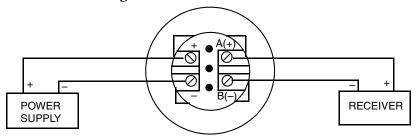

To wire a transmitter, proceed with the following steps.

- 1. Screw in cover lock (if present) and remove the field terminals compartment cover by rotating it counterclockwise.
- 2. Run the supply voltage and output wires (0.50 mm<sup>2</sup> or 20 AWG, typical) through one of the transmitter conduit connections as shown in Figure 30. If four-wire connection is used, use twisted single pair on the output side to protect the 1 to 5 V dc output from electrical noise.

#### - NOTE

Do not run transmitter wires in same conduit as mains (ac power) wires.

- 3. If shielded cable is used, ground the shield at the receiver **only**. Do **not** ground the shield at the transmitter. Cut and/or tape the shield so it cannot contact the metal housing.
- 4. Plug unused conduit connection with the metal plug provided (or equivalent). To maintain specified explosion proof and dust-ignition proof protection, plug must engage a minimum of five full threads. Thread sealant is recommended.
- 5. Connect an ground wire to the ground terminal in accordance with local practice.

### - ! CAUTION

If the output circuit must be grounded, it is preferable to do so at the negative terminal of the receiver. To avoid errors resulting from ground loops or the possibility of short-circuiting groups of instruments in a loop, there should be only one ground in a loop.

- 6. Connect the power supply and receivers (such as controllers, recorders, indicators) as shown in Figure 37 or Figure 38. Typical loop wiring is shown in Figure 39.
- 7. Install the cover onto the transmitter. Turn covers to seat O-ring into the housing and then continue to hand tighten until the cover contacts the housing metal-to-metal. If cover locks are present, refer to "Cover Locks" on page 48.
- 8. If wiring additional transmitters to the same power supply, repeat Steps 1 through 7 for each additional transmitter. The setup with multiple transmitters connected to a single power supply is shown in Figure 40.
- 9. For installations with long runs, it is recommended that two twisted pair with one pair connected to the power supply terminals and one pair connected to the output terminals are used. The two twisted pair can be in individual shields or a common shield with the shield connected to the receiver. The shield must **not** be connected to the transmitter.

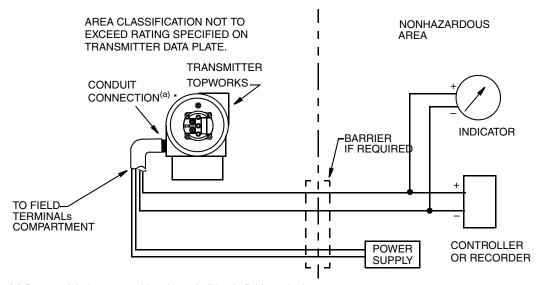


Figure 39. Loop Wiring (four-wire connection shown)

(a) Run conduit down to avoid moisture buildup in field terminals compartment.

POWER SUPPLY

TRANSMITTER

TRANSMITTER

TRANSMITTER

RECEIVER

RECEIVER

Figure 40. Wiring Several Transmitters to a Common Power Supply

NOTE: Four wire connection shown

### FoxCom Communications Protocol (Model Code -D)

The transmitter can be configured to send its pressure measurement to the I/A Series system as a digital signal using FoxCom protocol. Remote communication between the transmitter and the PC-Based Configurator or any I/A Series system console can be accommodated up to 600 m (2000 ft) away from the FBM.

#### - NOTE

Ensure that the transmitter output is configured for "digital output" before attaching it to an FBM that will be communicating in only the digital mode. Also, make sure that Device Name is the same as the letterbug used for that channel in the I/A Series System, or verify that the transmitter device name is set to its default description, DevNam, before installation.

Transmitters with FoxCom digital output signal connect to an I/A Series system. This procedure identifies wire terminations in the transmitter and in the I/A Series system enclosure. For other system wiring details, refer to the Installation Instructions provided with the I/A Series system.

The maximum total resistance for each transmitter loop is 420  $\Omega$  For example, if an intrinsically safe barrier with a resistance of 340  $\Omega$  is used, the maximum wire resistance is 80  $\Omega$  Maximum recommended length for field wire is 600 m (2000 ft). Transmitter power is supplied by the I/A Series FBM.


- 1. Remove the cover from the transmitter field terminal compartment.
- 2. Run signal wires (0.50 mm<sup>2</sup> or 20 AWG, typical) through one of the transmitter conduit connections as shown in Figure 41. Use twisted pair to protect the digital output and/or remote communications from electrical noise. Screened (shielded) cable may be required in some locations.

#### - NOTE

Do not run transmitter wires in same conduit as mains (ac power) wires.

- 3. If shielded cable is used, ground the shield at the field enclosure **only**. Do not ground the shield at the transmitter.
- 4. Plug unused conduit connection with the PG 13.5 or 1/2 NPT metal plug provided (or equivalent). To maintain specified explosion proof and dust-ignition proof protection, plug must engage a **minimum** of five full threads.

Figure 41. Typical Transmitter Wiring to an I/A Series System

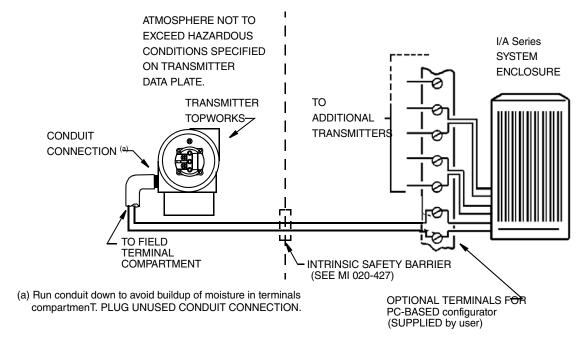

5. Connect an ground wire to the ground terminal in accordance with local practice. Ground terminal is shown in Figure 31.



To avoid errors resulting from ground loops or the possibility of short-circuiting groups of instruments in a loop, use only one ground in a loop.

- 6. Connect the signal wires to the transmitter "+" and "-" terminal connections shown in Figure 31.
- 7. The PC-Based Configurator can be connected via banana plugs to the top two receptacles (designated HHT) on the terminal block in the field terminal compartment as shown in Figure 31 or any other convenient location in the loop (subject to hazardous location restrictions). For example, to communicate with several transmitters from a single location, connect each pair of signal wires to a separate pair of terminals. The PC-Based Configurator can then be easily disconnected from one loop and connected to another.
- 8. Reinstall the cover on the transmitter. Turn the cover to seat the O-Ring into the housing and continue to hand tighten until the cover contacts the housing metal-to-metal.

### FOUNDATION Fieldbus Communication (Model Code -F)

Do not run transmitter wires in the same conduit as mains (ac power) wires.

Use FOUNDATION fieldbus approved cable (multi-core, shielded, twisted pair cable) to protect remote communications from electrical noise. Refer to MI 020-360 or FOUNDATION fieldbus Application Guide AG-140, Rev 1.0 or later.

Power supply (a FOUNDATION fieldbus Power Supply Module) must be capable of providing at least 14 mA for each transmitter connected.

A summary of the voltage requirements is listed in Table 15.

Table 15. Minimum Supply Voltage Requirements

Minimum Supply Voltage	9 V
Recommended Supply Voltage	24 V
Maximum Supply Voltage	32 V

The transmitter is equipped with an internal ground connection within the field wiring compartment and an external ground connection at the base of the electronics housing. To minimize galvanic corrosion, place the wire lead or terminal between the captive washer and loose washer on the external ground screw. Ground the shield at one place per segment **only**.

Refer to Figure 42 for wiring diagram.

ground screw field terminals i/a Series i.s. pressure transmitter run conduit down to avoid area classification not to exceed rating specified on transmitter moisture collection data plate in transmitter note: all devices located within hazardous area must be I.S. certified houşing plug unused conduit connection i.s. bus terminator\* other i.s. fieldbus devices use foundation fieldbus approved multi-core shielded, twisted-pair, cable. refer to foundation fieldbus app. guide AG-140, Rev 1.0 i.s. bus or later. terminator\* **HAZARDOUS AREA** intrinsic safety **NON-HAZARDOUS AREA** bus terminator\* nonhazardous location Foundation fieldbus fieldbus host interface a standard DEVICE supplied with approved foundation fieldbus fieldbus power supply software to make it a "link access scheduler" other fieldbus devices \*nEEDED ONLY FOR ISOLATING BARRIER bus terminator

Figure 42. Wiring Diagram of Typical FOUNDATION Fieldbus Transmitter Installation

## Installing Fieldbus Software (Model Code -F)


Device descriptions for I/A Series Foundation fieldbus transmitters are available for downloading from the website

http://iom.invensys.com/EN/Pages/Foxboro\_Mandl\_DocTools\_DeviceDescriptors.aspx

The files are:

Filename	Description	
xxyy.ffo	DD binary file	
where	xx = Device Rev. (Parameter 12 in Resource Block) yy = DD Rev. (Parameter 13 in Resource Block)	
xxyy.sym	DD symbol file	
xxyyzz.cff	Capability file (zz = cff rev)	

Set up the following directory structure for the DD files of a device on the host computer. According to the FOUNDATION specification, the device description files must be present in the appropriate directories as described below.

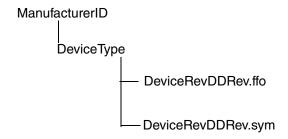

where \*.ffo is the DD binary file and \*.sym is the symbol file.

The Manufacturer ID for Foxboro is 385884 and the Device Type for this transmitter is BA30.

## Putting a Differential Pressure Xmtr Into Operation

The following procedure explains how to sequence the valves in your flow measurement piping or optional bypass manifold to ensure that your transmitter is not overranged and that seal liquid is not lost. Refer to Figure 23 or Figure 24.

## Procedure assumes that Process shutoff valves are open.

- 1. Make sure that both upstream and downstream manifold valves are closed.
- 2. Make sure that bypass valve is open.
- 3. Slowly open the upstream manifold valve.
- 4. Close the bypass valve.
- 5. Slowly open the downstream manifold valve.

## Taking a Differential Pressure Xmtr Out of Operation

The following procedure explains how to sequence the valves in your flow measurement piping or optional bypass manifold to ensure that your transmitter is not overranged and that seal liquid is not lost. Refer to Figure 23 or Figure 24.

#### - NOTE -

Procedure assumes that Process shutoff valves are open.

- 1. Close the downstream manifold valve.
- 2. Close the upstream manifold valve.
- 3. Open the bypass valve.
- 4. Carefully open the vent screw to release any residual pressure before disconnecting lines.



#### ─▲ WARNING -

When venting pressure from the transmitter, wear suitable protective equipment to prevent possible injury from process material, temperature, or pressure.

# 3. Operation Using Local Display

#### — NOTE

For analog output versions (electronics codes -A or -V), all configuration must be done from the optional local display. For intelligent versions (electronics codes -D, -T, and -F), you can configure most parameters using the local display. However, for more complete configuration capability, use a PC-Based Configurator or HART Communicator.

A local display, as shown in Figure 43, has two lines of information. The upper line is a 5-digit numeric display (4-digit when a minus sign is needed and 4-digit for electronics versions -A and -V); the lower line is an 7-digit alphanumeric display. The display provides local indication of measurement information. The primary (M1) measurement is normally displayed. To view the secondary (M2) measurement on intelligent versions, press the Enter button while in normal operating mode. Press the Next or Enter button to return to the primary measurement. If left in M2 display, an M2 message blinks in the lower right of the display. If power to the transmitter is interrupted, the display reverts to the M1 display.

#### - NOTE

With HART communication, the display can be configured to meet your specific needs. If configured Show 1, M1 is displayed. If configured Show 2, M2 is displayed. To temporarily view the alternate measurement, press the Enter button. After showing this measurement for a brief period, the display reverts to the configured display. If configured Toggle, the display toggles between M1 and M2. When M2 is displayed, an M2 message blinks in the lower right of the display. If power to the transmitter is interrupted, the display reverts to the configured display.

The display also provides a means for performing calibration and configuration, viewing the database, and testing the display via the 2-button keypad. You can access these operations by means of a multi-level menu system. Entry to the Mode Select menu is made (from normal operating mode) by pressing the Next button. You can exit this menu, restore your prior calibration or configuration, and return to the normal operating mode at any time by going to Cancel and pressing the Enter button.

#### - NOTE

During calibration or configuration, if an entry is Entered in error, use the Cancel feature to restore the transmitter to its starting configuration and begin again.

The following items can be selected from this menu: Calibration (CALIB). Configuration (CONFIG), Viewing the database (VIEW DB), and Testing the display (TST DSP). The top level structure diagram is shown in Figure 44.

#### - NOTE


VIEW DB is not applicable to Code -A and -V transmitters.

A 34.5 inH2O

NEXT PUSHBUTTON PUSHBUTTON (LATCHED [NONACTIVATING] POSITION)

Figure 43. Local Display Module

Figure 44. Top Level Structure Diagram

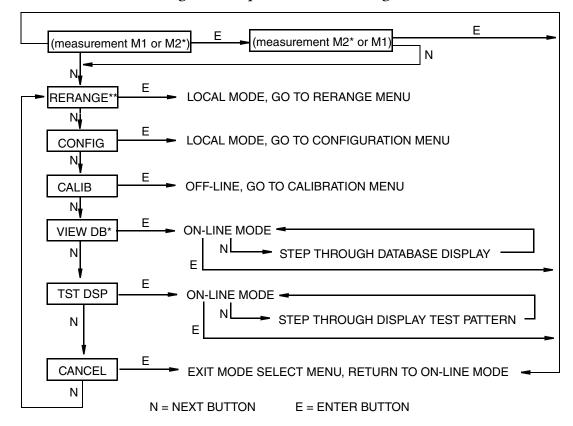

<sup>\*</sup>M2 AND VIEW DB NOT APPLICABLE TO MODEL CODE -A AND -V TRANSMITTERS

<sup>\*\*</sup>RERANGE ONLY APPLICABLE TO MODEL CODE -T TRANSMITTERS

#### - NOTE

In the Configuration menu and during adjustment of 4 and 20 mA (or 1 to 5 V dc) in the Calibration menu, the milliampere (or voltage) output does not reflect live measurement values. Also, during Calibration and Configuration menu operations, the I/A Series system identifies all transmitter measurements as BAD because the transmitter is not in the online mode.

## Moving Through the Menu Structure

The general procedure for moving through the menu structure is to use the Next button to select an item and the Enter button to specify your selection. See Figure 45 for an example of a typical menu structure. The example used is the beginning of the Configuration menu for a transmitter with FoxCom Communications.

IT MODE

4 - 20 mA

N

DIGITAL

E

DEVNAME

\*If character is not the last position on the display line, advances to next character.

\*If character is not the last position on the display line, advances to next character.

\*If character is not the last position on the display line, advances to next character.

Figure 45. Typical Menu Structure

In Figure 45, at the display IT MODE, press Enter. Use the Next button to select 4-20 mA or Digital and then Enter to specify your selection. The display advances to DEVNAME. Press Enter. Follow the general procedure below to select the letters for your device name. The procedure to enter letters is similar to that for entering numerical values.

advances to next menu item.

## **Entering Numerical Values**

The general procedure for entering numerical values in Calibration and Configuration is as follows:

- 1. At the appropriate prompt press the Enter button. The display shows the last (or default) value with the first digit flashing.
- 2. Use the Next button to select the desired first digit, then press the Enter button. Your selection is entered and the second digit flashes.
- 3. Repeat Step 2 until you have created your new value. If the number has less than five characters, use leading or trailing zeros for the remaining spaces. When you have configured the fifth space, the display prompts you to place the decimal point (SET DP).

- 4. Move the decimal point with the Next button until it is where you want it and press the Enter button.
- 5. The display advances to the next menu item.

- 1. The decimal point may not be placed directly after the first digit. For example, you can not enter a value as 1.2300; you must enter it as 01.230.
- 2. The decimal position is identified by flashing except at the position after the fifth digit. At that position (representing a whole number), the decimal point is assumed.

## Zeroing from the LCD Indicator Pushbuttons or Optional External Zero Button

Depending on the electronics version specified and whether or not the optional external zero adjust is specified, the transmitter can be zeroed with either the Lower Range Value pressure applied (CAL LRV) or zero pressure applied (CAL AT0).

The value of LRV pressure is settable and stored in the transmitter database. Apply a pressure equal to this value before activating CAL LRV.

CAL ATO allows easy zeroing of transmitters with non-zero based ranges. Before activating CAL ATO, gauge pressure transmitters must be vented to atmosphere and differential pressure transmitters must have zero differential pressure applied. Do not use CAL AT0 with remote seal transmitters having seals at different elevations from the transmitter or with vented absolute pressure transmitters.

The following table shows the zeroing functions supported by each electronics version.

	Electronics Versions		
Interface Method	D, F, and T	A and V	
LCD Pushbuttons (a)	CAL LRV and CAL AT0	CAL LRV and CAL AT0	
External Zero Option (b)	CAL LRV and CAL AT0	CAL ATO	

- a. Function selected from CALIB menu on LCD Indicator.
- b. On transmitters with Dual Function External Zero (Versions -D, -F, and -T), the zeroing is done by depressing the zero button:
  - < 3 seconds = CAL AT0
  - > 5 seconds = CAL LRV

#### Using the Optional External Zero Button:

An external zero adjustment mechanism in the electronics housing (see Figure 43) allows zeroing without removing the electronics compartment cover.

Zeroing is accomplished by depressing the zero button after it is unlatched.

Unlatch the zero button by turning the screw 90° counterclockwise so that the screwdriver slot lines up with the two holes in the face of the adjacent part. Do not push the button in with the screwdriver until ready to perform the zeroing operation.

## Zeroing from a HART Communicator

The electronics version -T transmitter can be zeroed from a HART Communicator. The transmitter can be zeroed with any applied pressure by entering the value of the applied pressure (one-point calibration).

Also, using the Zero Trim function on the HART Communicator provides the same function as a CAL AT0. To do this, the following requirements apply:

- ♦ Differential Pressure TransmitterH and L sides must be equalized
- ♦ Gauge Pressure Transmitter Must be vented to atmosphere
- ♦ Absolute Pressure Transmitter Full vacuum must be applied


#### – NOTE

Do **not** perform a Zero Trim procedure on an absolute pressure transmitter unless full vacuum is applied. The more common procedure for zeroing an absolute pressure transmitter is to vent it to atmosphere and do a one-point calibration, entering the current value of barometric pressure.

## 4. Calibration

## Calibration Diagram

Figure 46. Calibration Structure Diagram

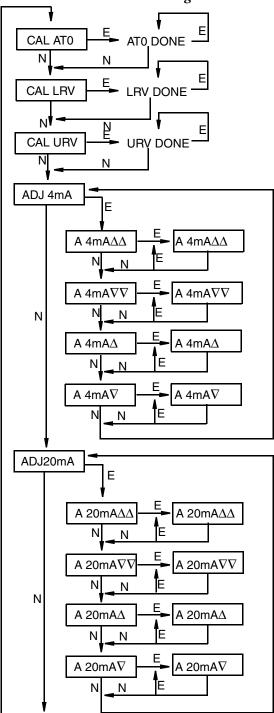

(continued on Figure 47)

E = ENTER N = NEXT

#### NOTES:

- 1. CAL AT0, CAL LRV, and CALURV apply to transmitters with FoxCom communications (Code -D), HART communications (Code -T), 4 to 20 mA Output (Code -A), and 1 to 5 V dc Output (Code -V).
- 2. For Code -V transmitters, substitute 1 V dc for 4 mA and 5 V dc for 20 mA throughout the diagram.
- 3. This diagram does **not** apply to transmitters with FOUNDATION fieldbus communication (Code -F). For calibration information on these transmitters, see the DVD.
- 4. CAL AT0, CAL LRV, and CAL URV require application of appropriate pressure before pressing ENTER. For reranging without pressure, see the next page.

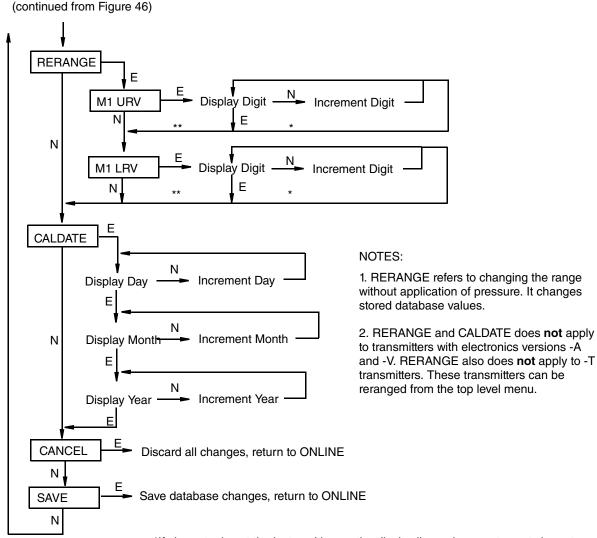


Figure 47. Calibration Structure Diagram (Continued)

\*If character is not the last position on the display line, advances to next character.

## Liquid Level Application Calibrated Range Values


Use the following to determine the upper and lower range values for Liquid Level applications. For similar information on Liquid Density or Liquid Interface Level applications, refer to MI 020-369 on the DVD with your transmitter.

The level range is a function of measured liquid head. The measurement may be in equivalent head of water units, such as  $inH_2O$  or  $mmH_2O$ . However, the numerical value in level units may be very different from the numerical value in equivalent head of water units. For example, a wet leg application may have a transmitter measurement range of -140 to -20  $inH_2O$  for a desired level measurement range of 0 to 150 inches.

The following illustrations show how to calculate the typical measurement ranges for various tank applications.

<sup>\*\*</sup>If character is the last position on the display line, advances to next menu item.

Figure 48. Transmitter Connected to Open Tank

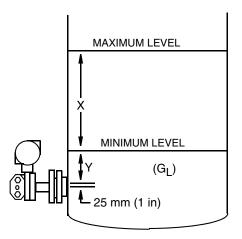

 $\begin{aligned} & Span = (X)(G_L) \\ & LRV = (Y)(G_L) \\ & URV = (X+Y)(G_L) \\ & Range = LRV \text{ to } URV \end{aligned}$ 


where:

X and Y are in the same units, such as in or

mm

G<sub>L</sub> = Specific gravity of the tank liquid LRV = Lower Range Value at minimum level URV = Upper Range Value at maximum level LRV and URV are in units of Equivalent

Figure 49. Transmitter Connected to Closed Tank with Dry Leg

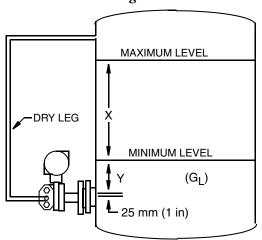


 $Span = (X)(G_L)$   $LRV = (Y)(G_L)$   $URV = (X+Y)(G_L)$  Range = LRV to URV

where:

X and Y are in the same units, such as in or mm  $G_L$  = Specific gravity of the tank liquid LRV = Lower Range Value at minimum level URV = Upper Range Value at maximum level LRV and URV are in units of Equivalent Head of Water, such as in  $H_2O$  or mm $H_2O$ 

Figure 50. Transmitter Connected to Closed Tank with Wet Leg

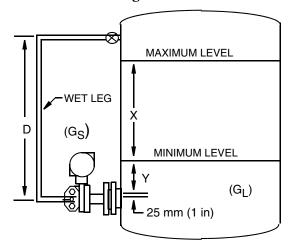

 $\begin{aligned} & Span = (X)(G_L) \\ & LRV = Y(G_L) - D(G_S) \\ & URV = (X+Y)(G_L) - D(G_S) \\ & Range = LRV \text{ to } URV \end{aligned}$ 

where:

X, Y, and d are in the same units LRV = Lower Range Value at minimum level URV = Upper Range Value at maximum level LRV and URV are in units of Equivalent Head of Water, such as  $inH_2O$  or  $mmH_2O$   $G_L$  = Specific gravity of the tank liquid GS = Specific Gravity of the capillary fill fluid

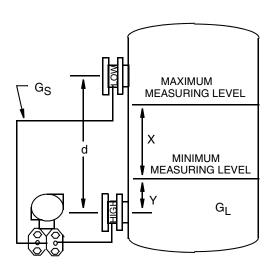


Figure 51. Transmitter Connected to Closed Tank With Dual Seals

 $Span = (X)(G_L)$   $LRV = (Y)(G_L) - (d)(G_S)$   $URV = (Y + X)(G_L) - (d)(G_S)$  Range = LRV to URV where:

X, Y, and d are in the same units
LRV = Lower Range Value at minimum level
URV = Upper Range Value at maximum level
LRV and URV are in units of Equivalent
Head of Water, such as inH<sub>2</sub>O or mmH<sub>2</sub>O

 $G_L$  = Specific gravity of tank liquid  $G_S$  = Specific Gravity of capillary fill fluid

Silicone (DC200, 10 cSt): 0.94 Fluorinert (FC77): 1.76 Silicone (DC200, 3 cSt):0.89 Silicone (DC704): 1.07 Neobee: 0.92

There are several methods that can be used to set up the transmitter for liquid level applications. These methods assume:

- ♦ The installation is complete, including any dry legs, wet legs (filled), and any seals are in place.
- The "zero level reference" is at or above the bottom pressure tap.
- ◆ The electronics have a 4 to 20 mA output (Analog) or 4 to 20 mA + digital output (HART or FoxCom).

### Method #1 - Calculating the range values

- ♦ This method relies on calculations only, so it can be used when there is no liquid in the tank yet or if there is liquid but at an unknown level.
- ♦ The 4 & 20 mA output points correspond to the calculated LRV and URV. Because the 4 to 20 mA signal is reranged to the entered LRV and URV, the transmitter calibration is unaffected.
- ♦ The local indicator, if present, can be set up to display 0 to 100%.
- If not configured for percent, the indicator will display the measured pressure, not the level. This is a drawback if you want to have the display read in level units (m, mm, in, or ft).
  - ◆ If you use a FoxCom transmitter, it supports custom units that can be used to display level.

♦ If you have a HART or Analog transmitter, you can use a pressure unit such as mmH<sub>2</sub>O or ftH<sub>2</sub>O to simulate mm or ft, if the specific gravity of the liquid is 1 or close enough to 1 to meet the required accuracy for display. Also, this requires that the minimum level point correspond to the elevation of the transmitter and it only applies to open tanks and closed tanks with a dry leg.

### **Procedure for Method #1**

Set LRV and URV equal to the calculated values.

# Method #2 - Using the Transmitters to Determine the Range Values

- ♦ This method uses the transmitter to determine the LRV and URV rather than having to calculate the values. It also has the advantage of zeroing the transmitter to account for minor installation tilt. However it requires the ability to change the liquid level in the tank to known points (minimum level corresponding to LRV and maximum level corresponding to URV).
- ♦ If the level can be put at the point corresponding to LRV but cannot be brought up to the point corresponding to URV, this method can also be used to automatically determine the LRV. Then the span can be calculated from the equations shown above and added to the LRV to determine URV for manual entry into the transmitter database. This variation on Method #2 can also be used when there is no liquid in the tank if the minimum level point is to be at the elevation of the bottom tap.
- The local indicator, if present, can be set up to display 0 to 100%.
- If not configured for percent, the indicator will display the measured pressure, not the level. This is a drawback if you want to have the display read in level units (m, mm, in, or ft).
  - A FoxCom transmitter supports custom units that can be used to display level.
  - ♦ A HART or Analog transmitter can use a pressure unit such as mmH<sub>2</sub>O or ftH<sub>2</sub>O to simulate mm or ft, if the specific gravity of the liquid is 1 or close enough to 1 to meet the required accuracy for display. However, this requires that the minimum level point correspond to the elevation of the transmitter and it only applies to open tanks and closed tanks with a dry leg.

### **Procedure for Method #2**

• For HART transmitters, using a HART Communicator having the appropriate DD installed, use the function "Rerange with Applied Pressure" when the liquid is at the minimum level point.

If the level can be raised to the maximum level, use "Rerange with applied pressure" for URV when the level is at the maximum point in the tank. If it is not practical or possible to raise the level to the maximum point, read the LRV that has been automatically entered and manually set URV = LRV + Span.

• For FoxCom and Analog transmitters, record the pressure reading at the minimum level point and enter it into the database for the LRV. Then, determine URV the same way or by adding the calculated span value to LRV.

## Method #3 - Getting the Local Indicator and Transmitted Value to Indicate Level - HART Transmitters

- ♦ When using a pressure unit, for example inH<sub>2</sub>O or mmH<sub>2</sub>O, to indicate level (liquids with SG =1), if the transmitter is not at the elevation corresponding to minimum level or if there is a wet leg or dual seals, the offset function can be used to have "zero" correspond to any desired level point regardless of the liquid head on the high or low side of the transmitter at that point.
- This does not affect the calibration of the transmitter.
- ◆ This offset procedure may be used for FoxCom transmitters but it is not required because custom units can be used.

#### **Procedure for Method #3**

- Even if the calculated LRV is not 0, set LRV = 0 and set URV = Span (calculated).
- With the level at the minimum level measurement point in the tank, read and record the pressure value displayed on the local indicator (if present) or the pressure value read from a HART Communicator.
- ♦ Enter this value for the M1EOFF parameter (called PV Offset if using a HART Communicator). Maintain the sign; that is, if the value is negative, enter it as a negative value.
- ♦ This procedure zeroes the transmitter and sets the 4 and 20 mA points corresponding to minimum and maximum level, respectively. The 20 mA point is based on the calculated span.
- ♦ If the liquid has the same density as water, the equivalent head of water units such as inH<sub>2</sub>O or mH<sub>2</sub>O can be used to represent the level in inches or meters on the local display or HART Communicator.

# Method #4 - Getting the Local Indicator and Transmitted Value to Indicate Level - Analog Output Transmitters

◆ The analog output transmitters do not have the offset function described above. Use this method if you want to use a pressure unit to indicate level when the pressure is not zero at minimum level, such as when a wet leg or dual seal is used. The liquid must have the same density as water in order to use equivalent head of water units such as inH₂O to indicate inches of level.

### **Procedure for Method #4**

- Even if the calculated LRV is not 0, set LRV = 0 and set URV = Span (calculated).
- ♦ With the level at the minimum level measurement point in the tank, zero the transmitter as if it had zero pressure on it (CAL ATO) using the local display). This procedure zeroes the transmitter and sets the 4 and 20 mA points corresponding to minimum and maximum level, respectively. The 20 mA point is based on the calculated span.
- ♦ The measured and indicated pressure at the minimum level measurement point is zero.
- ◆ This method shifts the calibration and is not suitable if the offset is greater than 50% of the maximum span limit for the selected transmitter. For example, if the range is -140 to -20 inH₂O, the transmitter would have to be a 'C' span or greater for this method to work. The maximum span of a 'B' sensor is 200 inH₂O and 50% of that is 100 inH₂O. Since the absolute value of the LRV in our example (140 inH₂O) is more than 100 inH2O. a 'B' sensor would not work. However since the maximum span of a 'C' sensor is 840 inH₂O and 50% of that is 420 inH₂O, it would work.

## 5. Configuration Diagrams

### FoxCom Communications (Code -D)

(Continued on Figure 53)

Figure 52. FoxCom Configuration Structure Diagram IT MODE DIGITAL 4 - 20 mA Ν E Ε N Increment Character Display Character -NOTES: **EX ZERO EXZ ENA EXZ DIS** 1. OUTFAIL sets mA output to go E, Е either High or Low under certain failure conditions, such as a sensor failure. **OUT REV OUT FWD OUT DIR** 2. Square root functions should not be selected on absolute and gauge Ε Εı pressure or flange level transmitters. FAIL HI FAIL LO **OUTFAIL** Ε E Display Implement **USER MA** LAST MA OFFL MA Digit Digit E Ε ΕV Ν DAMP 1/4 DAMP 1/2 DAMP 32 NO DAMP **DAMPING** E, Εı Ε Ν M1SQ<1C M1 LIN M1SQ<4L M1 MODE \*If character is not the last position on the display line, advances to next character.

\*\*If character is the last position on the display line, advances to next menu item.

77

(Continued from Figure 52) Ε CUSTM U PRESS U M1 EGU Ε Ν Ν psig psia mmH20 Е M1 LBL Display Character Ν M1EFAC Display Digit Increment Digit E M1EOFF Increment Digit Display Digit Ν **RERANGE** M1 URV Display Digit-Increment Digit M1 LRV Display Digit Increment Digit Е Ν Similar to M1 MODE except M2 MODE can be set to OFF M2 MODE Similar to M1 EGU M2 EGU NOTES: 1. M1EFAC and MIEOFF are used when custom units are selected, in order to establish the LRV and URV in the custom units. (Continued on Figure 54) 2. Percent Output is selectable CUSTM U.

Figure 53. FoxCom Configuration Structure Diagram (Continued)

<sup>\*</sup>If character is not the last position on the display line, advances to next character.

<sup>\*\*</sup>If character is the last position on the display line, advances to next menu item.

(continued from Figure 53) NOTES: 1. If configuring passwords, use care to record the password. Password protection applies to Ε CALDATE the pushbuttons. 2. The CLEAR DB function in SET GDB should not be selected unless a non-recoverable error Increment Day Display Day condition exists. It resets the database to default values, losing all user calibration and configuration settings. Reconfiguration and recalibration will be required. Increment Month Ν Display Month Ε Increment Year Display Year Ε **CFGONLY** NO PWDS CFG+CAL **ENA PWD** Ε Ε Ε **CFG PWD CAL PWD** N or E N or E Display Ν Increment Display Increment Character Character Character Character Εı Ε **CFG PWD** N or E See Note 2 Display Increment SET GDB CLEAR DB Performs Reset Character Character and returns E Ν to ONLINE CANCEL Discards all changes, returns to ONLINE Ν SAVE Saves database changes, returns to ONLINE


\*If character is not the last position on the display line, advances to next character.
\*\*If character is the last position on the display line, advances to next menu item.


Figure 54. FoxCom Configuration Structure Diagram (Continued)

<sup>79</sup> 

## HART Communications (Code -T)

Figure 55. Configuration Structure Diagram

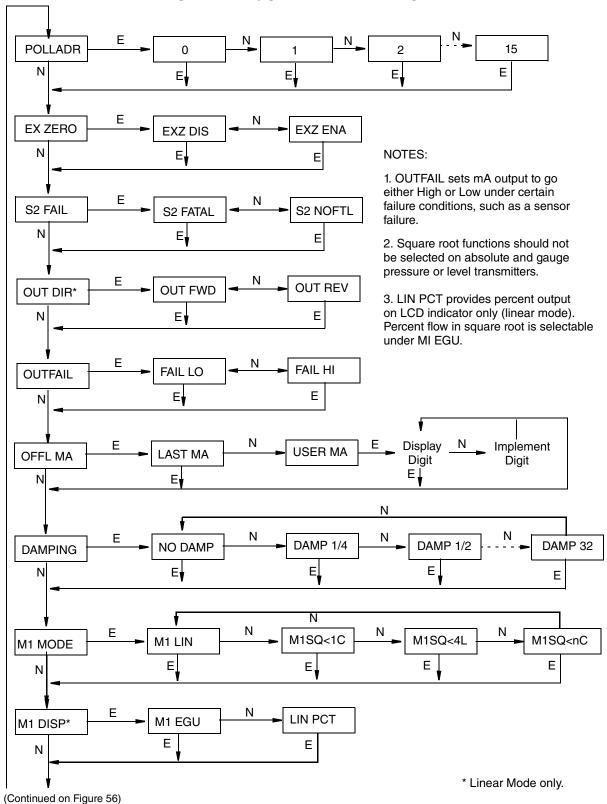

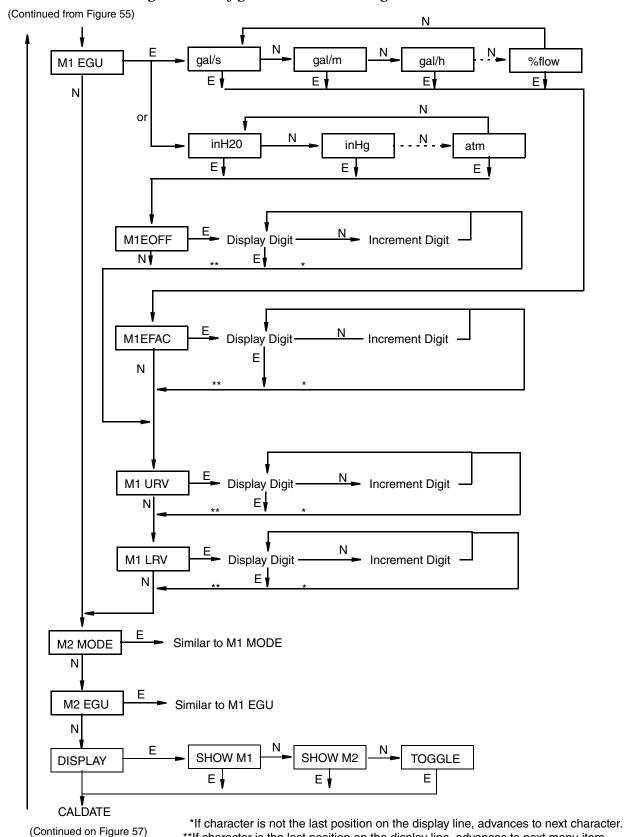

\*\*If character is the last position on the display line, advances to next menu item.

Figure 56. Configuration Structure Diagram (Continued)

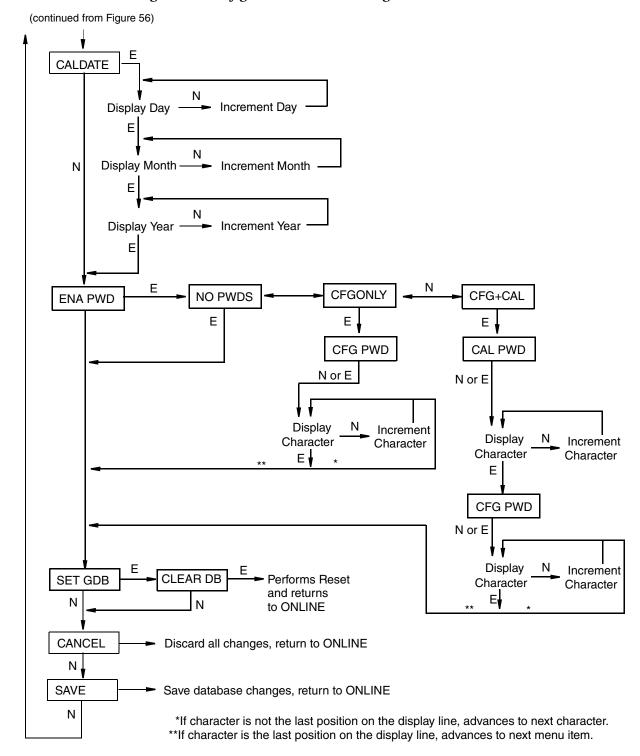


Figure 57. Configuration Structure Diagram (Continued)

## FOUNDATION Fieldbus Communications (Code -F)

Refer to the DVD with your transmitter.

SAVE

### 4 to 20 mA (Code -A) and 1 to 5 V dc (Code -V)

**EX ZERO** EXZ DIS **EXZ ENA** E Ε Ν Ε **REVERSE FORWARD OUT DIR** Εı Ε Ν SQ<4LIN SQ<1CUT LINEAR **OUTMODE** Е E Ε FAIL LO FAIL HI **OUTFAIL** Ε E Ν Ν DAMP 2 NO DAMP DAMP 4 DAMP 8 **DAMPING** E↓ Εv Ε, Ε SQUARE ROOT MODE LINEAR MODE DISPEGU **USE EGU USE PCT** Ε Ε Ν Increment INH2O **EGU SEI** ATM **EGU SEL** Display Character Character Ε Ε Ε Ν Ν N Increment Digit Display Digit → Increment Digit **EGU LRV** Display Digit-DSP URV N, N Display Digit N Increment Digit EGU URV CANCEL Ν SAVE **CANCEL** NOTES: 1. Do not use the external zero feature on transmitters having remote seals at different elevations

Figure 58. Configuration Structure Diagram (Code -A and -V)

- or with vented absolute pressure transmitters.
- 2. Square root functions should not be selected on absolute and gauge pressure or flange level transmitters.
- 3. Display in Linear Mode may be pressure units of calibrated range or percent (no custom units).
- 4. Display in Square Root Mode requires configuration of flow units or percent and allows user entry of URV in flow units.
  - \*If character is not the last position on the display line, advances to next character.
  - \*\*If character is the last position on the display line, advances to next menu item.

### **ISSUE DATES**

JAN 2000	MAR 2007	AUG 2010
APR 2002	MAY 2009	SEP 2015
SEP 2003	MAY 2010	

NOV 2004 JUN 2010

Vertical lines to the right of text or illustrations indicate areas changed at last issue date.

Invensys Systems, Inc. 10900 Equity Drive Houston, TX 77041 United States of America http://www.invensys.com Copyright 1999-2015 Invensys Systems, Inc. All rights reserved.

Invensys, Foxboro, and I/A Series are trademarks of Invensys Limited, its subsidiaries, and affiliates. All other trademarks are the property of their respective owners.

Foxboro Global Customer Support Inside U.S.: 1-866-746-6477

Outside U.S.: 1-508-549-2424

by Schneider Electric | Website: http://support.ips.invensys.com

Invensys is now part of Schneider Electric.

0915